

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

Mackinac Co.

4 Corners.

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 43 N. R. 10 E.	A-8
2. PROPERTY CONTROLLING IN SECTION	19 T. 43 N. R. 10 E.	7-Sec. 19, 6-Sec. 19 9-Sec. 19
3. MISCELLANEOUS PROPERTY IN SECTION	T. _____ N. R. _____ E.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 8-18, 1980, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

- A-8 Quarter Corner between Sec. 19, T43N R10W and Sec. 24, T43N R11W; set by Wm A. Burt, D.S. in 1841. Bearings were: Spruce 5", S54°E, 30 lks. and a Tamarack 6" for the corner
- 7-Sec. 19 North 1/16 Corner ^{of Sec's} ~~of Section~~ 19-20,
- 6-Sec. 19 North-East 1/16 Corner of Section 19.
- 9-Sec. 19 East 1/16 Corner of Section 19.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- A-8 Placed corner at a fence corner which agrees reasonably well with corner, one half mile South.
- 7-Sec. 19 Placed corner midway bet. $\frac{1}{2}$ cor. to ^{South} ~~North~~ and ^{Section} ~~Center~~ Corner to ^{North} ~~South~~.
- 6-Sec. 19 Placed corner at intersection of lines quartering the quarter section.
- 9-Sec. 19 Placed corner midway bet center of section and the East $\frac{1}{2}$ corner. Corner lies 61' East and 3.0' North of North and East fence.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- Placed 1" pipe with 4" aluminum cap at all four corners. Bearings:
- A-8 6" Cedar, N25°E, 14.6' & 5" Cedar, S48°E, 7.0' & 5" Cedar, S81°W, 5.3'.
 - 7-Sec. 19 14" Twin Maples, S10°W, 9.7' & 12" R. Maple, N85°W, 45.6' & 12" H. Maple, N52°E, 54.8'.
 - 6-Sec. 19 6" H. Maple, S43°W, 17.2' & 10" H. Maple, S17°W, 28.3' & 8" H. Maple, N84°W, 39.3'.
 - 9-Sec. 19 10" H. Maple, N42°W, 12.2' & 6" H. Maple, N80°W, 39.4' & 12" H. Maple, South, 45.4'.

SIGNED BY _____ DATE 10-9-80

Billy D. Buckler

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____

MICHIGAN REGISTERED LAND SURVEYOR

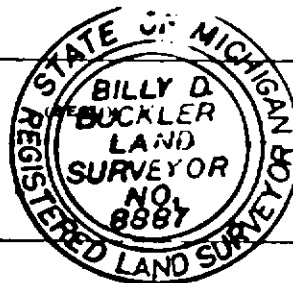

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____