

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

Mackinac Co.

3 Corners.

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>43</u> N. <u>X</u> R. <u>10</u> W.	<u>A-11, B-11, C-11</u>
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ N. _____ S. _____ R. _____ E. _____ W. _____	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. _____ S. _____ R. _____ E. _____ W. _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, \_\_\_\_\_, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

**A. Description of original monument and accessories and/or subsequent restoration:**

A-11 set by Wm. A. Burt, D.S. in 1841. B-11 and C-11 set by Wm. Ives, D.S. in 1849.

A-11 Sec. Cor. 30-31, T43N R10W and Sec's. 25-36, T43N R11W. Bearings were: W. Birch, 12" S15°W, 17 lks. and Aspen 8", N51°E, 24 lks. and Aspen 10", S40°E, 26 lks. and Aspen 8", N75°E, 06 lks.

B-11 Quarter corner bet. sec's. 30-31. Bearings were: W. Birch 7", S10°W, 15 lks. and Y. Birch 5", North, 16 lks.

C-11 Sec. Cor. 29-30-31-32. Bearings were: Tamarack 6", N64°E, 17 lks. and Tamarack 5", S40°W, 59 lks.

**B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:**

A-11 Replaced corner at a wood post in fence corner. Position checks well with corner 1/2 mile East. Found corner in SW corner of a small clearing. No evidence of original corner.

B-11 Found large corner fence post. Found several such posts along line to East. No evidence of original witnesses. 1939 air photo shows what appears to be an old road North and South at this corner. We find an old road, 30' to West of corner. Position of corner checks well with a corner 1/2 mile West and the proportioned position of cor. 1/2 mile East.

C-11 Re-established Cor. by single prop. meas. bet. cors. 1 mile North and 1 mile South. Distance checks well to corners West.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

Set 1" pipes with 4" aluminium cap at all corners.

A-11 New Bearings:  
8" W. Birch, S58°E, 19.6'  
8" W. Birch, N21°E, 46.5'


B-11 New Bearings:  
7" Soft Maple, S13°E, 27.7'  
9" W. Spruce, N67°E, 31.9'  
10" Cedar, N85°W, 81.8'

C-11 New Bearings:  
8" Cedar, S40°E, 73.1'  
10" Balsam, N35°E, 36.5'

SIGNED BY Billy D. Buckler  
Billy D. Buckler

DATE 9/20/77

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

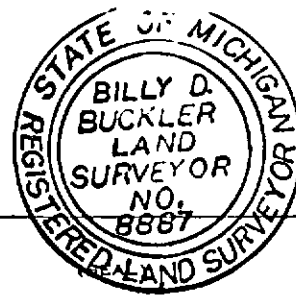

**FOR STATE AND UNITED STATES AGENCIES:**

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_