

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

Mackinac Co.

3 Corners.

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY_____	T. <u>43</u> N. <u>X</u> , R. <u>10</u> W.	B-10 B-9
2. PROPERTY CONTROLLING IN SECTION <u>30</u>	, T. <u>43</u> N. <u>X</u> , R. <u>10</u> W.	12-Sec.30
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____ N. _____, R. _____ E. _____	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 10-3, 1978, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

B-10 Center Corner of Section 30.

B-9 Quarter Corner bet. Sec's 19-30, set by Wm Ives, D.S. in 1849.
Bearing were: Fir 6", S60°W, 25 lks. and Beech 6", N30°E, 18 lks.

12-Sec.30 South 1/16 Corner of Section 30.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

B-10 Placed corner at intersection of lines connecting opposite quarter corners. Found evidence of a cleared road, very old, approx. on the N-S quarter line and part of the E-W 1/4 line, East of the Center Corner.

B-9 Restored corner as indicated by the Mich. State Hvy. Plan. Found R.O.W. Mon. South (83.15') and a fence line to North.

12-Sec.30 Placed corner midway bet. Center corner to North and quarter corner to South. Corner lies 2.6' West of a N-S fence line, on West edge of old N-S road.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

B-10 Chiseled an "X" in surface of solid limestone rock. Bearings are: 6" S. Maple, N50°E, 16.9' & 6" S. Maple, S69°E, 17.85' & 8" S. Maple, S73°W, 33.0'. Corner lies SE of an old road intersection.


B-9 Buried 36" "T" Iron at corner. New Bearings: 6" S. Maple, S38°E, 56.2' and 8" Beech, S10°W, 51.15' and 18" Hemlock, S52°W, 97.75' and Center Line of US-2, North, 17.0'.

12-Sec.30 Placed 1" pipe with 4" aluminium cap at corner. Bearings: 16" Spruce, S29°E, 13.8' and 12" Spruce, N55°E, 25.5' and 6" W. Birch, S78°W, 30.1'.

SIGNED BY Billy D. Buckler DATE 2-9-79

Billy D. Buckler

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

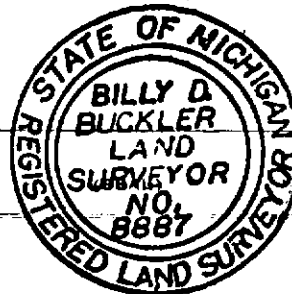

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____

MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____