

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

Mackinac Co.

3 Corners.

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. <u>43</u> N. R. <u>12</u> W.	<u>G-9, G-8, F-9</u>
2. PROPERTY CONTROLLING IN SECTION	T. _____ N. S. R. _____ E. W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION	T. _____ N. S. R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 1-13 & 1-16, 1981, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:  
Corners set by Guy H. Carlton, D.S. in 1849, bearing were:

- G-9 Sec. Cor. 21-22-27-28. Sugar 16", N10°E, 25 lks. & Beech 8", S66°W, 20 lks.
- G-8 Quarter Cor. bet. Sec's. 21-22. Cedar 10", N16°E, 05 lks & Cedar 6", S1°W, 11 lks.
- F-9 Quarter Cor. bet. Sec's. 21-28. Hemlock 10", N18°W, 20 lks. & Hemlock 18", S55°E, 08 lks.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:  
G-9 Corner placed according to M.S.H.D. Plan, from the old and new road locations.

G-8 Found a wood post and iron pipe, checks well with sec. cor. to South. Stream to North. Many Cedars but none could be identified. Corner appears to be about the age of the Hwy. survey.


F-9 Found 1/2" Iron, agrees with M.S.H.D. Plan.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:  
G-9 Buried a 36" "T" Iron at corner. New Bearings: 12" R. Pine, N80°E, 122.15' & 10" R. Pine, N25°W, 30.6' & 10" R. Pine, N56°W, 33.05'.

G-8 Placed 1" pipe with 4" aluminum cap at corner. New Bearings: 10" Cedar, N7°E, 31.5' & 8" Tamarack, S42°W, 42.8'.

F-9 Re-witnessed 1/2" Iron (Buried). New Bearings: 5" Spruce, N36°W, 79.75' & 8" Spruce, N21°E, 51.00'

SIGNED BY Billy D. Buckler DATE 2-19-81  
 Billy D. Buckler  
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

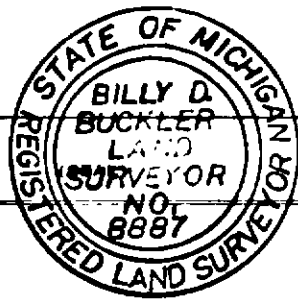

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
CHIEF OF SURVEY PARTY  
 APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
MICHIGAN REGISTERED LAND SURVEYOR

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_