

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

Mackinac Co.

4 Corners.

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>43</u> N. S. R. <u>12</u> E. W.	G-6, M.C. G-6A M.C. 3A-Sec.22
2. PROPERTY CONTROLLING IN SECTION <u>22</u>	T. <u>43</u> N. S. R. <u>12</u> E. W.	3-Sec.22
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. S. R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 1-13 & 1-14, 19 81, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

- G-6 1/4 Cor. bet. Sec's. 15-16, set by Guy C. Carlton D.S. in 1849. Bearings were: W. Birch 8", S59°E, 30 lks. & Y. Birch 6", N39°W, 24 lks.
- G-6A Meander Cor. bet. Sections 15-16, on North side of Long Lake. Bearings were: Tam 5", N59°E, 32 lks. & Tam. 5", N44°W, 34 lks.
- 3-Sec.22 North 1/16 corner on West side of section 22.
- 3A-Sec.22 Meander corner, North of the North 1/16 corner, on West side of section 22, and on South side of Long Lake. Bearings were: Cedar 10", S8°E, 38 lks. & Cedar 8", S61°W, 49 lks.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:


- G-6 Restored corner by single prop. measure bet. corners to North and to the South. No evidence of original corner.
- G-6A Restored Meander Corner on line and on North edge of Long Lake. Monument is 25.0' North of proportionate distance to fit lake shore.
- 3-Sec.22 Placed corner by single prop. measure bet. Meander Corner to North and 1/4 Cor. to South.
- 3A-Sec.22 Placed corner by single pro. measure bet. corners to North and South. Location checks with present lake shore.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Placed 1" pipe with 4" aluminum cap at all corners. Bearings are:

- G-6 12" hemlock, N37°E, 31.4' & 8" Cedar, N77°E, 22.8' & 12" Y. Birch, N83°W, 42.2'. Corner lies on east side of a hardwood island.
- G-6A 8" Tam., N68°W, 56.7' & 6" Tam., N12°E, 31.9' & 4" Tam., N74°E, 22.8'.
NOTE: This is 25.0' North of record position.
- 3-Sec.22 8" Cedar, S33°W, 8.0' & 8" Cedar, S83°W, 11.1' & 8" Cedar, N63°W, 14.6'.
- 3A-Sec.22 10" Cedar, S78°W, 22.3' & 10" Cedar, S5°W, 36.4' & 8" Cedar, S47°E, 29.1'.

SIGNED BY Billy D. Buckler DATE 2-19-81
 Billy D. Buckler
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

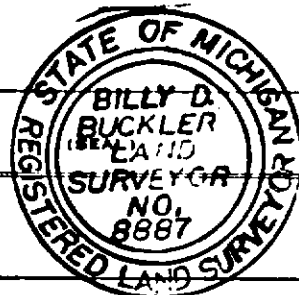

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____