

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

Mackinac County

4 Corners


FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>44</u> ^{N.} S., R. <u>7</u> ^{E.} W.	<u>F-10, G-9, I-9, I-8</u>
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ N. S., R. _____ E. W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. S., R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 12-14-78, 5-16-79, 19____, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

- A. Description of original monument and accessories and/or subsequent restoration:
- Sec. Cor. and 1/4 Cors. set by H. Brevort Jr., D.S. in 1845. Bearings were:
- F-10 Center corner, Section 28.
 - G-9 Sec. Corner 21-22-27-28: beech 12, N36°E, 57 lks. hemlock 16, S69°W, 12 lks.
 - I-9 Sec. Cor. 22-23-26-27: hemlock 26, S53 1/2°E, 48 lks. hemlock 18, N60°E, 64 lks.
 - I-8 1/4 Corner bet. Secs. 22-23: beech 10, S57°W, 41 lks - beech 14, S53°E, 25 lks.
- B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
- F-10 Placed corner at intersection of lines, connecting opposite quarter corners.
 - G-9 Placed corner in center of a N-S road, and by proportionate measure to north and south. This road is an old abandoned railroad grade, metal detector picks up many railroad spikes.
 - I-9 Restored corner by D.P.M. from corners in all four directions. Found no evidence of orig. cor.
 - I-8 Restored corner, midway and on line bet two Sec. Cors. Found no evidence of original Cor.
- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
- F-10 Placed 1" pipe w/4" alum. cap, at corner. No witnesses available. Corner lies 23' north of a trail road.
 - G-9 Buried 36" "T" iron in road, New bearings: 15" j. pine, N78°E, 41.6'-16" r. pine, S58°E, 36.0' Found north edge of a pine plantation, 12' to north, to east of here.
 - I-9 Placed 1" pipe w/4" alum cap, at corner. New bearings: 6" cedar, N38°W, 8.2'-6" cedar, N11°E, 35.8'-7" spruce, S36°E, 16.3' Corner lies 65' east of log road.
 - I-8 Placed 1" pipe w/4" alum. cap, at corner. New bearings: 8" hard maple, S88°E, 20.1'-14" beech, S15°E, 26.9'-12" hard maple, N68°W, 4.2'

SIGNED BY Billy D. Buckler DATE 3-18-80
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

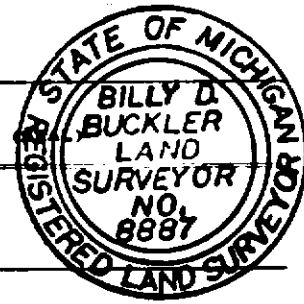

FOR STATE AND UNITED STATES AGENCIES:
 SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY
 APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR (SEAL)