

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970
Mackinac Co. 4 Corners

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>44</u> N. <u>3</u> , R. <u>7</u> E. <u>W.</u>	<u>J-9, K-9, G-10, H-9</u>
2. PROPERTY CONTROLLING IN SECTION _____	, T. _____ N. S., R. _____ E. W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____ N. S., R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 9-29, 5-16-79, 19____, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

- Sec. Cor. and $\frac{1}{4}$ Cors. set by H. Brevort Jr. D.S. in 1845. Bearings were:
- J-9 $\frac{1}{4}$ Cor. bet. Sec's 23-26: a Hemlock 12 inches for corner.
 - K-9 Sec. Cor. 23-24-25-26, : Spruce 4, N 19⁰W, 35 lks. and Spruce 3, S35⁰E, 18 $\frac{1}{2}$ lks.
 - G-10 $\frac{1}{4}$ Cor. bet. Sec's 27-28: maple 4, N43⁰E, 04 lks. and hemlock 12, N71⁰W, 25 lks.
 - H-9 $\frac{1}{4}$ Cor. bet. Sec's. 22-27: Tamarack 6, S56⁰W, 10 lks. and tamarack 6, N22⁰E, 13 lks.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- J-9 Restored corner midway and on line bet. two Sec. Cors.
- K-9 Restored corner by D.P.M. from corners in all four directions.
- G-10 Restored corner midway and on line bet. two section corners.
- H-9 Restored corner midway and on line bet. two Sec. Cors.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- J-9 Placed 1" pipe w/4" alum cap at corner. New bearings are:
6" W. Birch, S5⁰E, 26-4'-16" spruce, S74⁰W, 43.1'-8" R. Maple, N7⁰E, 30.1'
- K-9 Placed 1" pipe w/4" alum. cap at corner. No witnesses available.
Corner lies in an open wet marsh. Found old wood post 70.7' south of corner.
- G-10 Placed 1" pipe w/4" alum. cap at corner.
9" cedar, S45⁰W, 9.7' - 10" tamarack, S73⁰E, 32.2'.
Corner lies 30' south of road, and 6.0' south of centerline of road to west, and in line with west edge of road to north.
- H-9 Buried 36" "T" Iron, at corner.
6" cedar, N12⁰W, 32.6' - 14" cedar, S72⁰W, 53.6'-centerline of road, S44⁰E, 17.4'


SIGNED BY _____ DATE 3/18/80

Billy D. Buckler
SURVEYOR'S MICHIGAN REGISTRATION NO. _____

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

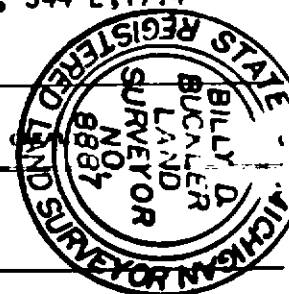

SURVEYOR'S MICHIGAN REGISTRATION NO. _____