

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

3 Corners

Mackinac Co.

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. <u>44</u> N. R. <u>7</u> E.	C-9, C-10, C-11
2. PROPERTY CONTROLLING IN SECTION	T. _____ N. S., R. _____ E. W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION	T. _____ N. S., R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 7-28-80, 1980, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corners placed by H. Brevoort Jr. D.S. in 1845. Bearings were:

- C-9 Sec. Cor. common to Sec's. 19-20-29-30. Tam 6", S46°E, 10 lks. & Tam 6", N49°E, 19 lk
- C-10 Quarter Corner bet. Sec's. 29-30. Sugar 14", S71°W, 12 lks. & Birch 20", S57°E, 25 lk
- C-11 Sec. Cor. common to Sec's. 29-30-31-32. Tam 12, N42°E, 16 lks. & Tam 5", N47°W, 27 lk

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- C-9 Restored corner on a line of old blazes to North and South. Position determined from notes by Marcus Schaaf, R.L.S. who indicated the corner was found in 1937. We could find no remains of Schaafs' corner.
- C-10 Restored corner midway and on line bet. two Sec. Cors. Found no evidence of original corner.
- C-11 Restored Sec. Cor. by double prop. measure from cors. in all four directions. Corner lies in marsh and on South edge of an East-West ridge.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Placed 1" pipe with 4" Aluminium cap at all corners. New Bearings:


- C-9 5" Cedar (S30 NBT), S83°W, 9.4' & 5" Cedar (S19 NBT), N18°W, 18.2' & 6" Cedar, (S29 NBT), 34°E, 19.5. Corner lies 40' East of an old trail.
- C-10 7" J. Pine, (1/2 S NBT), S50°W, 48.6' & 8" J. Pine, (1/2 S NBT), West, 42.8' & 12" Red Pine, (1/2 S NBT), N12°W, 97.5'.
- C-11 6" B. Spruce, (S31 NBT), S41°W, 3.2' & 7" B. Spruce, (S29 NBT), N79°E, 8.4' & 8" Tamarack, (S32 NBT), S44°E, 10.5'.

SIGNED BY Billy D. Buckler DATE 7-30-80
Eilly D. Buckler
SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

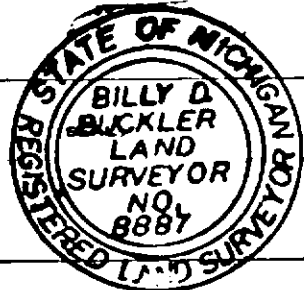

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

FORM APPROVED BY MICHIGAN STATE BOARD OF REGISTRATION, JAN. 28, 1971
REVISED MAY 14, 1975

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET