

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Mackinac
 (County)

Located In:	Corner Code #
1. Public Land Survey	T ___ R ___
	T ___ R ___
	T ___ R ___
	T ___ R ___
2. Property Controlling in Section	S <u>15</u> T <u>44</u> R <u>7</u> W <u>8</u>
	S <u>15</u> T <u>44</u> R <u>7</u> W <u>12</u>
3. Miscellaneous Property in Sec.	S ___ T ___ R ___
	S ___ T ___ R ___

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Aug 05 2002

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:


A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	16		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
 (8-Sec. 15) West 1/16 corner, Section 15. 1981 record of Billy D. Buckler: Established corner midway and on line bet. 1/4 cor. to west and computed center of sec. 15. 1" pipe with 4" alum. cap. 10" R.Maple N4W 9.3', 7" H.Maple S84E 32.5'.
 (12-Sec. 15) South 1/16 corner, Section 15. Not established in the original survey.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
 (8-Sec. 15) Found but did not accept the 1981 monument. The 1981 position for the corner is erroneous as a result of an error in measurement. Established the corner midway and on a straight line between Quarter corner 1302.49' west and Center of Sections 1302.49' east. Monumented the position with the 1981 monument. The 1981 witnesses were not recovered. From the corner monumented the 1981 position bears N57W 6.5' distant.
 (12-Sec. 15) Established the corner midway and on a straight line between Quarter corner 1312.25' south and Center of Section 1312.25' north.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
 (8) Set 1"IDx36" I.pipe with 4" alum. MDNR cap. Blazed, scribed, and set measuring nails in:
 5" twin Cherry N40E 33.5' "W1/16 BT"
 8" Maple in clump N48W 12.4' do
 10" Balsam S31W 27.6' do
 5" Balsam S15W 31.1' do
 Bearings are magnetic. Distances are to nail with tag.
 (12) Set 1"IDx36" I.pipe with 4" alum. MDNR cap. Blazed, scribed, and set measuring nails in:
 8" Spruce S74E 17.2' "S1/16 BT"
 8" Maple N04W 9.25' do
 10" Spruce N76W 24.65' do
 6" Maple S11W 23.65' do
 Set cedar post adjacent. Bearings are magnetic. Distances are to nail with tag.

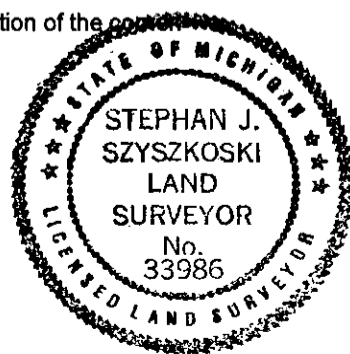

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 8/7/02