

85

**LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in  
Mackinac

Located In:

Corner Code #

1. Public Land Survey

T44N R 8W C2

T R

T R

T R

2. Property Controlling  
in Section

S 6 T44N R 8W 9

S T R

3. Miscellaneous  
Property in Sec.

S T R

S T R

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

Sep 18 1995

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 19\_\_\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6	5										
3													
4	7			8		9		10		11		12	
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

**A. Description of original monument and accessories and/or subsequent restoration:**


(C2) Quarter corner common to Sections 5-6. Corner reestablished in 1969 by Billy D. Buckler, RLS by proportionate measure between Section corner south and Closing corner north. Buckler placed a 1" pipe with 4" aluminum cap and marked 14" Hard Maple N18E 42.0' (9-Sec. 6) East 1/16 corner, Section 6. Corner recorded by Billy D. Buckler, RLS in 1974: "Corner placed midway and on line bet. 1/4 cor. to east and center corner to West. Placed 1" pipe with 4" aluminum cap at corner, 10' north of road, 6" J. Pine N52W 25.3', 5" R. Pine N29E 39.7".

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

(C2) Found Buckler's monument, as described, in good condition, and at record bearing and distance from his 1969 witness, now a 3 ft. high stump. Left the monument in place and marked new witnesses as described below.  
(9-Sec. 6) Found Buckler's monument, as described, in good condition, and at record bearing and distance from his 1974 accessories. Determined that the monument was placed at an erroneous location in 1974: 117.31' east and 0.96' north of the position described in Section A above. Removed the monument and placed it on a straight line between Center of Section 1322.07' west and Quarter corner 1322.07' east. Defaced the 1974 witness trees.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

(C2) Found 1" pipe with 4" MDNR cap.	(9) Set 1" iron pipe with 4" MDNR cap.
Blazed, scribed, and set measuring nails	Blazed, scribed, and set measuring nails
in the following:	in the following:
13" R. Pine N39E-19.1' "1/4S NBT"	6" R. Pine N41W 23.75' "E1/16 NBT"
8" R. Pine N10W 37.4'	12" R. Pine N14W 18.1'
11" R. Pine N44W 19.75'	12" R. Pine N47E 22.5'
9" R. Pine N19W 35.5'	4" Spruce S22E 57.05'
Bearings are magnetic.	South 22' centerline of E-W road.
	Placed a 4" squared and scribed post adjacent. Bearings are magnetic.

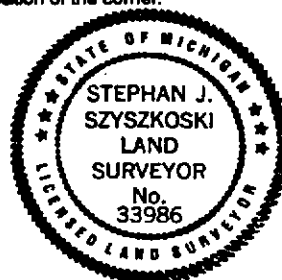

Signed by

*Stephan J. Szyszkoski*

Date

11-29-95

Surveyor's Michigan License No.

33986

For the Michigan Department of Natural Resources - Forest Management Division