

83

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Mackinac

Located in:

Corner Code #

(County)

1. Public Land Survey

T 44N R 8W C1

T R

T R

T R

2. Property Controlling
in Section

S 6 T 44N R 8W 7

S T R

3. Miscellaneous
Property in Sec.

S T R

S T R

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

7 Aug 29 1995

C1 Sep 20 1995

Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

(C1) Closing corner common to Sections 5-6. Corner restored in 1969 by Billy D. Buckler, RLS at the location of an old Cedar post. Buckler placed a 1" pipe with 4" aluminum cap and marked a 16" Y. Birch S18E 8.4'.

(7-Sec. 6) North 1/16 corner between Sections 5-6. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(C1) Found Buckler's monument as described, in good condition, and at record bearing and distance from the 1969 witness Y. Birch. Also found the Standard corner for Sections 31-32 T45N-R8W Westerly 24.40' marked by a similar monument. This corner is being recorded in order to update the accessories.

(7-Sec. 6) Found no evidence of prior monumentation at the corner position. Established the corner 20 chains, proportionate to the original record, north of the quarter corner between Sections 5-6 and on a straight line between the quarter corner and the closing corner between Sections 5-6. The Quarter corner was found 1328.26' south and the closing corner 1276.45' north. At the position for the corner I placed a 1" IDx36" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(C1) Found 1" pipe with 4" MDNR cap.

(7) Set 1" pipe with 4" MDNR cap.

Blazed, scribed, and set measuring nails in the following trees:

Blazed, scribed, and set measuring nails in the following bearing trees:

18" Y. Birch S10E 9.0' "S32"

16" R. Pine S86W 24.8' "N1/16 BT"

12" Cedar East 10.1' "S32 NBT"

6" Balsam N25E 11.0'

14" Cedar N76W 5.0' "S31 NBT"


3" Maple N63E 4.65'

1" pipe with 4" MDNR cap West'ly 24.40'

5" W. Birch S60E 11.9'

Bearings are magnetic.

Bearings are magnetic.

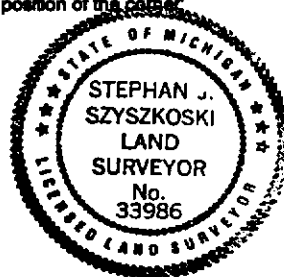

Signed by

Stephan J. Szyszkoski

Date

11-29-95

Surveyor's Michigan License No.

33986

For the Michigan Department of Natural Resources - Forest Management Division

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 26, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983
REVISED OCT., 1986

W. HOITENGA