

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

Mackinac Co.

3 Corners.

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>44</u> N. R. <u>10</u> W.	<u>G-5, G-4</u>
2. PROPERTY CONTROLLING IN SECTION <u>9</u>	T. <u>44</u> N. R. <u>10</u> W.	<u>3-Sec.9</u>
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. S. R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 8/12, 1977, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

- G-5 & G-4 set by Wm. Ives, D.S. in 1849.
- 3-Sec.9 North 1/16 Corner on West side of Sec. 9 T44N R10W.
- G-5 Sec. Corner 9-10-15-16.
- G-4 Quarter corner bet. Sec's. 9-10.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:


- 3-Sec.9 Corner set midway bet. Sec. Cor. to North and $\frac{1}{4}$ Cor. to South.
- G-5 Placed corner in intersection of roads, North, South, and West. No evidence of original corner.
- G-4 Re-established corner midway and on line bet. two Sec. Cors. Found no evidence of any corner. Corner lies in west side of county road.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- 3-Sec.9 Placed 1" pipe with 4" aluminium cap at corner.
New Bearings: 6" Maple, N88°E, 6.1' and 8" Maple, S5°W, 18.7'.
Corner lies 52.7' East of center line M-117.
- G-5 Buried 36" "T" iron at corner. New Bearings: 16" Spruce, N58°E, 50.4'.
- G-4 Buried 36" "T" iron at corner. New Bearings: 10" Cedar, S56°E, 54.5' and 8" Cedar, N82°E, 48.9'.

SIGNED BY Billy D. Buckler
 Billy D. Buckler
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

DATE 9/20/77

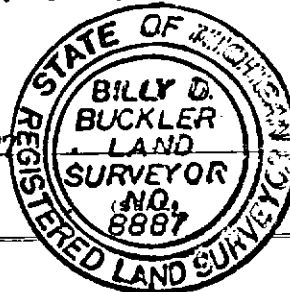

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR (SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____