

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

Mackinac Co.

2 Corners.

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>44</u> N. R. <u>10</u> W.	<u>F-3</u>
2. PROPERTY CONTROLLING IN SECTION <u>5</u>	T. <u>44</u> N. R. <u>10</u> W.	<u>2-Sec.5</u>
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. R. _____ W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 4-27 & 6-12, 1978, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

F-3 Quarter Corner between Sec's, 4-9, set by Wm Ives, D.S. in 1849.
Bearings were: Maple 9, N78°E, 14 lks. and Hemlock 9, S58°W, 14 lks.

2-Sec.5 East 1/16 Corner on Northside of Section 5.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

F-3 Corner replaced at buried 1 1/2" iron pipe in center of road (E-W). Found pipe 28" deep. Found 3/4" irons bearing S88°E, 49.6' and N8°W, 49.6' from corner. These irons are both in N-S fence lines. Believe corner iron placed before 1938, when road was raised.


2-Sec.5 Placed corner midway between 1/8" Corner to West and Section Corner to East.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

F-3 Buried 36" "T" Iron at corner.
New Bearings: 8" Cedar, S14°W, 52.2' and 7" Cedar, N6°E, 35.6'.

2-Sec.5 Bearings: 12" Beech, S25°E, 16.9' and 14" Beech, S55°W, 12.9' and 16" Beech, N40°W, 8.9'.
Placed 1" pipe with 4" aluminium cap at corner.

SIGNED BY Billy D. Buckler DATE 9-11-78
 Billy D. Buckler
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

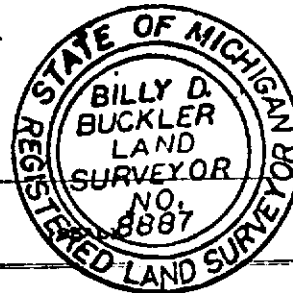

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY
 APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR (SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____