

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in  
Mackinac

(County)

Located in:

Corner Code #

**1. Public Land Survey**

T 44N R 10W E3

T \_\_\_\_\_ R \_\_\_\_\_ \_\_\_\_\_

T \_\_\_\_\_ R \_\_\_\_\_ \_\_\_\_\_

T \_\_\_\_\_ R \_\_\_\_\_ \_\_\_\_\_

**2. Property Controlling in Section**

S 8 T 44N R 10W 14

S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_ \_\_\_\_\_

**3. Miscellaneous Property in Sec.**

S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_ \_\_\_\_\_

S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_ \_\_\_\_\_

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

14 Jul 21 1997

E3 Jul 22 1997

I, Stephan J. Szyzkoski, in a field survey on \_\_\_\_\_, 19\_\_\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below.

**NOTE:** Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

|    | A  | B | C  | D | E  | F | G  | H | I  | J | K  | L | M |
|----|----|---|----|---|----|---|----|---|----|---|----|---|---|
| 1  |    |   |    |   |    |   |    |   |    |   |    |   |   |
| 2  | 6  |   | 5  |   | 4  |   | 3  |   | 2  |   | 1  |   |   |
| 3  |    |   |    |   |    |   |    |   |    |   |    |   |   |
| 4  | 7  |   | 8  |   | 9  |   | 10 |   | 11 |   | 12 |   |   |
| 5  |    |   |    |   |    |   |    |   |    |   |    |   |   |
| 6  | 10 |   | 17 |   | 16 |   | 15 |   | 14 |   | 13 |   |   |
| 7  |    |   |    |   |    |   |    |   |    |   |    |   |   |
| 8  | 19 |   | 20 |   | 21 |   | 22 |   | 23 |   | 24 |   |   |
| 9  |    |   |    |   |    |   |    |   |    |   |    |   |   |
| 10 | 30 |   | 29 |   | 28 |   | 27 |   | 26 |   | 25 |   |   |
| 11 |    |   |    |   |    |   |    |   |    |   |    |   |   |
| 12 | 31 |   | 32 |   | 33 |   | 34 |   | 35 |   | 36 |   |   |
| 13 |    |   |    |   |    |   |    |   |    |   |    |   |   |

**A. Description of original monument and accessories and/or subsequent restoration:**  
 (E3) Corner common to Sections 4-5-8-9. 1977 record by Billy D. Buckler, M.L.S.: Placed section corner record distance (307.56') East of an original W. Pine line tree. Found a re-rod at Dept. of Hwy. location, which is 9.0' North and 25.92' West of our corner. Placed 1" pipe with 4" aluminum cap at corner. New bearings 12° Spruce S27E 47.7'. Corner lies 59.06' East of center line of M-117. According to Gary Koepke PS, Design Surveys, Michigan Dept. of Transportation, the records of the Design Surveys unit contains no information which will substantiate the MDOT position as the original position for the corner. This position would most likely have been established or perpetuated from local evidence in 1948 by MDSH. The undersigned made no effort to obtain the 1948 MDSH field notes. (14-Sec. 8) South 1/16 corner between Sections 8-9. Corner not established in the original survey. Found no subsequent record.


**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

(E3) Recovered the 1977 monument as described, a 1" ID iron pipe capped with a 4" dia. cast aluminum MDMR tablet, in good condition, and at record bearing and distance from the spruce NBT, in good condition. Buckler's tie to the centerline of M-117 also checks. Left the monument in place, marked a new top blaze on the 1977 NBT, and marked 3 new accessories as described below. A 1/2" rebar was recovered at the MI Dept. of Transportation position, in the east ditch of M-117, bent and evidently slightly disturbed, and M74 deg. 18 min 48 sec. W, 28.45' from the corner monument (NA083(1994) grid bearing and distance). Corner recovered and re-witnessed by T. Stark and M. Feldpausch, Newberry District Office.

(14-Sec. 8) Established the corner midway and on a line of mean true bearing between Quarter corner 1318.50' north and Section corner 1318.50' south. At the position for the corner I placed a 1" IDx36" iron pipe capped with a 4" dia. cast aluminum tablet, appropriately stamped. Corner placed and witnessed by T. Stark, Newberry District Office. From the corner monumented, I found a 1" iron pipe, not of record, 37.8' East and 1.6' North.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

|  |  |
|--|--|
| (E3) Found 1" pipe with 4" MDMR cap.                       | (14) Set 1" pipe with 4" MDMR cap.                         |
| Blazed, scribed, and set measuring nails in the following: | Blazed, scribed, and set measuring nails in the following: |
| 18" Spruce S27E 47.7' "S9"                                 | 3" Maple S80E 35.4' "S1/16 BT"                             |
| 5" Balsam S48E 9.9' "S9 NBT"                               | 18" Maple N87E 32.4' "S1/16 BT"                            |
| 5" Cherry N82E 8.2' "S4 NBT"                               | 8" Maple N75E 41.7' "S1/16 BT"                             |
| 5" Twin Maple N02E 44.6' "S4 NBT"                          | Fd. 1" pipe N87E (true brg.) 37.84'                        |
| Bearings are magnetic.                                     | Centerline of M117 is 40' West.                            |
|  | Bearings are magnetic unless noted.                        |

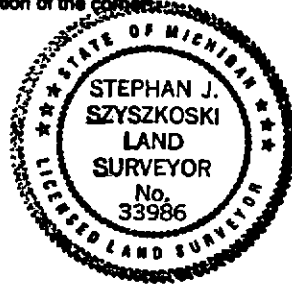

Signed by

*Stephan J. Szyzkoski*

Date

7/6/98

Surveyor's Michigan License No.

33986

For the Michigan Department of Natural Resources - Forest Management Division