LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in Mackinac Located In: Corner Code # 1. Public Land Survey 2. Property Controlling in Section 3. Miscellaneous


Register of Deeds Stamp & File Number

4. Lot No. Recorded Plat 5. Private Claims

Jul 23 1997 C3 Jul 22 1997

Stephan J. Szyszkoski , in a field survey on <u>,</u> 19 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monut recovered, found as expressed below:

NOTE: Not more than 2 comers, all in the same town and range, may be recorded on this certificate.

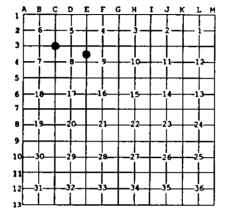

A Description of original monument and accessories and/or subsequent restoration:
(C3) Corner common to Sections 5-6-7-8. 1976 record by Billy D. Buckler, RLS: "Corner reestablished by proportionate measure to North and South and at record distance from a fence corner 1/2 mile West. Corner lies on Worth edge of an old RR grade. Placed 1° pipe with 4" aluminum cap at corner. New bearings 12" B. Cherry N78E 16.6', 10" B. Cherry S40W 53.1'

(7-Sec. 8) North 1/16 corner between Sections 8-9. 1977 record by Billy D. Buckler, RLS: "Corner set midway between Sec. Cor. to North and 1/4 Cor. to South. Placed 1" pipe with 4" aluminum cap at corner. 6" Maple M88E 6.1', 8" Maple SOSM 18.7', Corner lies 52.7' East of center line M-117".

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(C3) Recovered the 1976 monument as described, a 1° ID iron pipe capped with a 4° dia. cast aluminum MDNR tablet, in good condition, and at record bearing and distance from the SN 8. Cherry witness, in good condition. Left the monument in place and marked three new accessories as described below. Corner recovered and rewitnessed by T. Stark, Newberry District Office.

(7-Sec. B) Recovered the 1977 monument as described, a 1° ID iron pipe capped with a 4° dia. cast aluminum MDNR tablet, in good condition, and at record bearing and distance from the Maple ME 87, in good condition. My measurements north to Section corner and South to reestablished Quarter corner are \$318.53' and \$1318.46', respectively. This monument is 0.21' Mest of a straight line between them. I accepted the monument as a careful and faithful determination of the position of the corner. Left the monument in place and marked new accessories as described below.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner.

(C3) Found 1 pipe with 4 MONR cap.

(7) Found 1 pipe with 4 MONR cap.

Blazed, scribed, and set measuring mails

Blazed, scribed, and set measuring nails

in the following: 16" Charry \$38# 53.4"

5" Cherry N23E 5.5'

4" Cherry N40E 5.2"

6" Cherry N78E 16.1'

Property in Sec.

in the following:

"N1/16"

8" Maple NBBE 6.2"

"N1/16 BT" 14" Maple S44E 9.4" 5" Maple SIOW 13.6" "M1/16 BT"

6" Maple WO4W 4.95" "H1/16 BT" Bearings are magnetic.

Placed a 3" squared and scribed post adjacent. An E-W trail is 10° South. Bearings are magnetic.

S7

"S5 NBT"

"SS MBT"

"S5 N8T"

For the Michigan Department of Natural Resources - Forest Management Division

STEPHAN J

SZYSZKOSKI

LAND

SURVEYOR

33986

AND S'