

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

Mackinac Co.

4 Corners.

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>44</u> N. <u>11</u> E. <u>W.</u>	M-5, K-4, L-3
2. PROPERTY CONTROLLING IN SECTION _____	T. <u>44</u> N. <u>11</u> E. <u>W.</u>	11-Sec.12
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. _____ E. <u>W.</u>	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 8-13 & 6-20, 1980, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

- M-5 Sec. Cor. to Sec's. 12-13, T44N R11W and Sec's. 7-18, T44N R10W, set by Wm A. Burt, D.S. in 1841. Bearings were: Beech 8", N22°E, 12 lks. & Beech 6", N53°W, 26 lks. 1849 bearings; Fir 9", S28°E, 49 lks. & Y. Birch 7", N30°E, 13 lks.
- K-4 1/4 Cor. bet. Sec's. 11-12, set by Wm Ives, D.S. in 1849. Bearings were: Beech 8", N25°W, 27 lks. & Sugar 10", S41°E, 30 lks.
- 11-Sec.12 South-West 1/16 Corner of Section 12.
- L-3 1/4 Cor. bet. Sec's. 1-12, set by Wm Ives, D.S. in 1849. Bearings were: Fir 8", S60°E, 42 lks. & Beech 9", N40°W, 11 lks.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- M-5 Placed corner at intersection of county roads to North, South and West. Found no other evidence. This position appears to agree with old blazed lines in this section.
- K-4 Restored corner midway and on line bet. two Sec. Cors. No evidence of original corner.
- 11-Sec12 Placed corner at intersection of lines quartering the quarter section. Found old blazes east and west of corner.
- L-3 Placed 1/4 corner midway bet. two sec. cors. and on North edge of E-W road. Found several blazes on H. Maple trees in vicinity. This recording will replace record dated 3-6-70.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- M-5 Buried 36" "T" Iron in Road. New Bearings: 8" H. Maple, N38°W, 62.8'. & 10" Beech, N54°E, 71.9' & 10" Y. Birch, S67°E, 42.6'.  
Placed 1" pipe with 4" aluminum cap at next three corners.
- K-4 No new witnesses available. Corner lies in an open clear cut area.
- 11-Sec.12 8" H. Maple, S55°W, 6.0' & 18" Beech, S85°E, 23.8' & 12" Beech, N24°E, 21.3'.
- L-3 16" H. Maple, N71°W, 12.7' & 16" H. Maple, S63°W, 32.2' & 12" H. Maple, N69°E, 3.2'


SIGNED BY \_\_\_\_\_ DATE 10-17-80

Billy D. Buckler  
SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
MICHIGAN REGISTERED LAND SURVEYOR

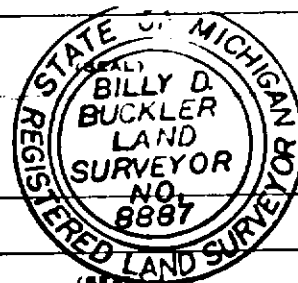

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_

FORM APPROVED BY MICHIGAN STATE BOARD OF REGISTRATION, JAN. 28, 1971  
REVISED MAY 14, 1975

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET