

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

Mackinac Co.

4 Corners

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____ T. _____	N. _____ S., R. _____ E. _____	_____
2. PROPERTY CONTROLL- 12 _____ T. 44 _____ ING IN SECTION _____	N. _____ S., R. 11 _____ E. _____	14-Sec.12, 10-Sec.12 12-Sec.12, 13-Sec.12
3. MISCELLANEOUS PROPERTY IN SECTION _____ T. _____	N. _____ S., R. _____ E. _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND  
FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 8-11 & 9-15, 1980, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

**A. Description of original monument and accessories and/or subsequent restoration:**

- 14-Sec.12 South 1/16 Corner on East side of Section 12.
- 10-Sec.12 South 1/16 Corner on West side of Section 12.
- 12-Sec.12 South 1/16 Corner of Section 12.
- 13-Sec.12 South-East 1/16 Corner of Section 12.

**B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:**

- 14-Sec.12 Placed corner midway bet. 1/4 corner to North and Sec. Cor. to South. Found old blazes on green timber along the entire South 1/16 line, Sec. 12.
- 10-Sec.12 Placed corner midway bet 1/4 corner to North and Sec. Cor. to South.
- 12-Sec.12 Placed corner midway bet Center corner and the South 1/4 corner.
- 13-Sec.12 Placed corner at intersection of lines quartering the quarter section.


**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

- 14-Sec.12 Buried 36" "T" Iron in North-South road. Bearings: 22" Beech, S71°E, 14.2' & 16" Beech, N21°E, 31.1' & 8" H. Maple, N79°W, 21.1'.
- Placed 1" pipe with 4" aluminum cap at the next three corners. Bearings:
- 10-Sec.12 18" Y. Birch, S17°E, 23.4' & 12" Beech, S87°E, 23.9' & 14" H. Maple, N1°E, 24.3'.
- 12-Sec.12 12" H. Maple, S20°W, 25.2' & 10" H. Maple, N39°W, 29.6' & 8" H. Maple, N55°E, 30.0'.
- 13-Sec.12 12" Beech, N71°E, 17.3' & 8" Beech, S58°E, 30.5' & 7" Beech, S36°W, 18.1'.

SIGNED BY \_\_\_\_\_ DATE 10-17-80  
Billy D. Buckler  
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
CHIEF OF SURVEY PARTY  
 APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
MICHIGAN REGISTERED LAND SURVEYOR

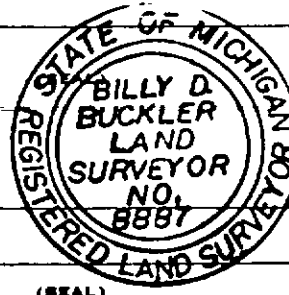

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_

FORM APPROVED BY MICHIGAN STATE BOARD OF REGISTRATION, JAN. 26, 1971  
REVISED MAY 14, 1975

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET