

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

54

For corners in
Mackinac

(County)

Located In:

Corner Code #

1. Public Land Survey

T ___ R ___
T ___ R ___
T ___ R ___
T ___ R ___

2. Property Controlling
in Section

S 10 T 44N R 11W 13
S 10 T 44N R 11W 5

3. Miscellaneous
Property in Sec.

S ___ T ___ R ___
S ___ T ___ R ___

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

5 Apr 11 1996

13 May 14 1996

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													


A. Description of original monument and accessories and/or subsequent restoration:
(13-Sec. 10) Southeast 1/16 corner, Section 10. Corner not established in the original survey. Found no subsequent record.
(5-Sec. 10) North 1/16 corner, Section 10. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(13-Sec. 10) Found no monumentation at the corner position. Established the corner at the intersection of straight lines connecting opposite 1/16 corners. The 1/16 corners to the East, South and West are monumented. That to the north is not currently monumented. At the position for the corner, I placed a 1" IDx36" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Corner lies on the edge of a hill. Corner placed by T.Stark and D.Lampela, Newberry.
(5-Sec. 10) Found no monumentation at the corner position. Established the corner midway and on a straight line between 1/4 corner 1320.10' north and Center of Section 1320.10' south. At the position for the corner, I placed a 1" IDx36" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed by T.Stark and D.Lampela, Newberry.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(13) Set 1" pipe with 4" MDNR cap.	(5) Set 1" pipe with 4" MDNR cap.
Blazed, scribed, and set measuring nails in the following:	Blazed, scribed, and set measuring nails in the following:
10" Cherry N28E 26.6' "SE1/16 8T"	6" Cedar N47W 8.2'
16" Cherry N41E 20.2' "SE1/16 8T"	6" Cedar N16E 15.45'
5" Balsam N78E 9.9' "SE1/16 8T"	12" Cedar East 23.5'
24" Maple N28W 17.2' "SE1/16 8T"	14" Cedar S14E 9.55'
Placed a squared and scribed cedar post adjacent. Bearings are magnetic.	Placed a 5" squared cedar post adjacent. Bearings are magnetic.

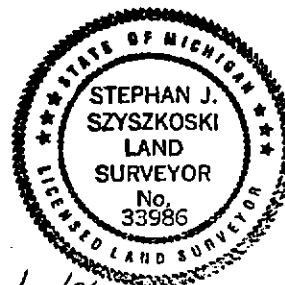

Signed by Stephan J. Szyszkoski
Surveyor's Michigan License No. 33986

Date 6/25/96

For the Michigan Department of Natural Resources - Forest Management Division