LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970


Nackinac	Located in:	Comer Code #		
(County)				
1. Public Land Survey	T <u>44</u> NR TR TR TR	110 12		
Property Controlling in Section Miscellaneous Property In Sec.	S_2 T_44NR S_ T_R S_ T_R S_ T_R	11# 12		

Register of Deeds Stamp & File Number

4. Lot No, Re	Recorded Plat			
5. Private Claims				
		12	Sep 29 1998	

12 Sep 30 1998 Stephan J. Szyszkoski _, in a field survey on . do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented recovered, found as expressed below:

NOTE: Not more than 2 comers, all in the same town and range, may be recorded on this certificate.

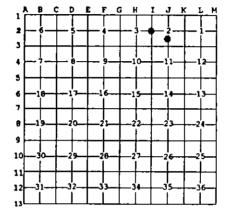

A. Description of original monument and accessories and/or subsequent restoration;

(12) Quarter corner common to Sections 2-3. According to the first transcription of the original GLO notes, the corner was established in 1849 by William Ives as follows: "South corrected...38.40 Set qr. section post. Cedar 7 East 13, do 10 S80M 15... 78.44 Section corner". The GLO plat approved Feb. 13, 1850 by Charles Moble, Surveyor General show regular measurements along the West line of Section 2 with the only fractional measurement being 18.44 ch. on the west side of the government lot.

(12-Sec. 2) South 1/16 corner, Section 2. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner.

(12) Original post and accessories not recovered. Found no acceptable evidence of the position of the original corner on the ground. Reestablished the corner 40 chains, proportionate to the original plat record, 2626.53' north of the Section corner common to 2-3-10-11, on a line of mean true bearing between that corner and the corner common to 2-3 744N-R11M and 34-35 745N-R11M which is 2524.09' North. At the position for the corner I placed a 1" ID x 36" iron pipe capped with a 4" dia. cast aluminum HDMR tablet, appropriately stamped. Corner placed and witnessed by T.Stark and M.Feldpausch, Memberry District Office. (12-Sec. 2) Found no evidence of prior monumentation at the corner position. Established the corner midway and on a straight line between Center of Section 1312.48' Morth and Quarter corner 1312.48' South. At the position for the corner I placed a 1' ID x 36' iron pipe capped with a 4" dia. cast aluminum MDMR tablet, appropriately stamped. Corner placed and witnessed by T.Stark and M.Feldpausch, Newberry District Office.

(I2) Set I pipe with 4 MONA cap.	accessories established to perpetuate locating the po- (12) Set 1" pipe with 4" MDNR cap.	smon of the comer.
Blazed, scribed, and set measuring nails	Blazed, scribed, and set measuring nails	************
in the following:	in the following:	111 0 0 0
10" Cedar S27E 14.45" "1/45 MBT"	8" Ironwood N42E 7.95" "S1/16 BT"	STEPHAN
8" Cedar N46E 19.55' "1/45 H8T"	10" Ironwood N30W 6.85' "\$1/16 BT"	SZYSZKO
6° Cedar S02E 4.15' "1/4S MBT"	14° Maple \$54W 20.15' "\$1/16 BT"	LAND
6" Cedar N82W 15.25" "1/45 N8T"	14" Maple 509N 21.65" "S1/16 BT"	SURVEYO
Placed a 4" squared and scribed cedar post adjacent. Bearings are magnetic.	Placed squared and scribed cedar post adjacent. Placed location poster on 6°	No.
care adjuster.	maple Approx. 210' East on N-S trail.	33986
0-111	Brearings are magnetic.	AND 8

Signed by Victor

For the Michigan Department of Matural Resources - Forest Management Division