

**LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Mackinac</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>44N</u> R <u>11W</u>	<u>L3</u>
	T <u>    </u> R <u>    </u>	<u>    </u>
	T <u>    </u> R <u>    </u>	<u>    </u>
	T <u>    </u> R <u>    </u>	<u>    </u>
2. Property Controlling In Section	S <u>12</u> T <u>44N</u> R <u>11W</u>	<u>2</u>
	S <u>    </u> T <u>    </u> R <u>    </u>	<u>    </u>
3. Miscellaneous Property in Sec.	S <u>    </u> T <u>    </u> R <u>    </u>	<u>    </u>
	S <u>    </u> T <u>    </u> R <u>    </u>	<u>    </u>

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

Aug 14 1998

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 19\_\_\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

**A. Description of original monument and accessories and/or subsequent restoration:**

(L3) Quarter corner common to Sections 1-12. Corner reestablished in 1980 by Billy D. Buckler, RLS: "Placed 1/4 corner midway bet. two sec. cors. and on North edge of E-W road. Found several blazes on H. Maple trees in vicinity. This recording will replace record dated 3-6-70. Placed 1" pipe with 4" aluminum cap. 16" H. Maple N71W 12.7', 16" H. Maple S63W 32.2', 12" H. Maple N69E 3.2'. (2-Sec. 12) East 1/16 corner between Sections 1-12. Corner established in 1979 by Billy D. Buckler, RLS: "Placed corner midway bet. Sec. Cor. to East and 1/4 cor. to West. Placed 1" pipe with 4" aluminum cap. 24" R. Maple N74W 29.5', 8" H. Maple N25E 23.0'".


**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner.**

(L3) Recovered the 1980 monument as described, a 1" ID iron pipe capped with a 4" dia. cast aluminum MDNR tablet, in good condition, and at record bearing and distance from the 1980 witnesses, all in good condition. My measurements show this monument to be 0.06' East of the midway location intended in 1980. I accept the monument as a careful and faithful reestablishment of the position of the original corner. Made one new witness as described below. Corner recovered and rewitnessed by T. Stark and M. Feldpausch, Newberry District Office.

(2-Sec. 12) The 1979 monument was removed by unknown parties. Remonumented the corner as follows: 1) at record bearing and distance from the 1979 witnesses, both recovered in good condition; 2) midway and on a straight line between 1/4 corner to west and Section corner to east (1331.42' West and East) and; 3) in the remains of the hole created by the removal of the 1979 monument. At the position for the corner, I placed a 1" ID x 36" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed and witnessed by T. Stark and M. Feldpausch, Newberry District Office.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner.**

(L3) Found 1" pipe with 4" MDNR cap. Blazed, scribed, and set measuring nails in the following: 20" Maple N74W 12.95' "1/4S" (1980 wit) 20" Maple S64W 32.1' "1/4S" (1980 wit) 16" Maple N71E 3.25' "1/4S" (1980 wit) 12" Beech N36W 13.4' "1/4S HBT" Bearings are magnetic. Placed a 5" squared and scribed cedar post adjacent.	(2) Set 1" pipe with 4" MDNR cap. Blazed, scribed, and set measuring nails in the following: 30" Maple N72W 29.7' "E1/16" (1979 wit) 14" Maple N31E 23.25' "E1/16" (1979 wit) 10" Maple N79W 12.85' "E1/16 BT" 10" Maple N60E 37.65' "E1/16 BT" Bearings are magnetic. Placed a 5" squared and scribed cedar post adjacent.
---	---

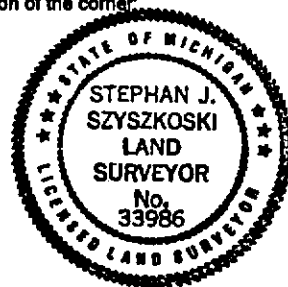

Signed by Stephan J. Szyszkoski  
Surveyor's Michigan License No. 33986

Date 11/18/98

For the Michigan Department of Natural Resources - Forest Management Division