

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Mackinac</u>	Located in:	Corner Code #
(County)		
1. Public Land Survey	T44N R 11W	K5
	T44N R 11W	J3
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

J3 Sep 29 1998
K5 Aug 19 1998

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5		4		3			2			1
3												
4	7	8		9		10			11			12
5												
6	18	17		16		15			14			13
7												
8	19	20		21		22			23			24
9												
10	30	29		28		27			26			25
11												
12	31	32		33		34			35			36
13												


A. Description of original monument and accessories and/or subsequent restoration:
(K5) Corner common to Sections 11-12-13-14. Corner reestablished in 1980 by Billy D. Buckler, RLS: "Placed corner in center of East-West road and in line with a fence to South. Found remains of an old fence to North. Buried 36" T-iron. 6" H. Maple NSOW 43.6', 12" H. Maple N10E 27.7', 8" H. Maple N32E 37.3".
(J3) Quarter corner common to Sections 2-11. Corner reestablished in 1984 by Gerald L. Wiggins, RLS: "Corner set M.P.O.L. between Section Corners 1/2 mile East and West. Set D.N.R. monument. 7" H. Maple N23E 10.5', 12" H. Maple N70E 14.0', 10" Y. Birch S34E 14.5', 14" Beech, N88W 6.5".

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(K5) Recovered the 1980 monument, as described, in good condition, and at record bearing and distance from the 1980 witness trees, all in good condition. Left the monument in place, set measuring nails in the record accessories, and marked one new tree as described below. Corner recovered and re-witnessed by T.Stark and M.Feldpausch, Newberry District Office.
(J3) Recovered the 1984 monument as described, in good condition, and at record bearing and distance from the 1984 accessories. I determined that the 1984 monument was placed at an erroneous and unintended location approximately 25' SSE of the proper position. I rejected the existing monument, removed it, and reinstalled it midway and on a line of mean true bearing between Sections corners 2653.91' East and West. Corner placed and witnessed by T.Stark and M.Feldpausch, Newberry District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(K5) Found T-iron. Set measuring nails in the following existing witnesses: 12" Maple N35E 37.5'	(J3) 1" pipe with 4" MDNR cap. Blazed, scribed, and set measuring nails in the following:
16" Maple N11E 28.1'	16" Beech S13E 20.7' "1/4S NBT"
8" Maple N49W 43.7'	8" Maple S57E 19.45' "1/4S NBT"
Blazed, scribed, and set meas. nail in:	16" Maple S58E 30.75' "1/4S NBT"
5" Maple N12W 23.45' "S11 NBT"	12" Y. Birch S31E 39.3' "1/4S NBT"
Bearings are magnetic.	Placed squared cedar post adjacent. Corner is south of an E-W trail. Bearings are magnetic.

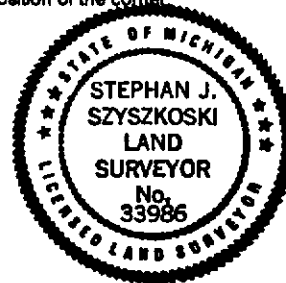

Signed by Stephan J. Szyszkoski
Surveyor's Michigan License No. 33986

Date 11/18/98

For the Michigan Department of Natural Resources - Forest Management Division