

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF—:	LOCATED IN—:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 24 N. R. 13 W.	L-3
2. PROPERTY CONTROLLING IN SECTION	12, T. 24 N. R. 13 W.	8; 9
3. MISCELLANEOUS PROPERTY IN SECTION	, T. S. R. E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER _____

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on June 23, 1976, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- L-3 Found 1" pipe that fits same corner position as recovered by RLS H.R. Bruning in 1968. Corner also seems to fit survey of Sec. 1 as noted in large brown liber of county surveyor record at Register of Deeds, page 246, dated 1911.
- 8 Established 1/16 corner equidistant & on line between found center of Sec. to E and found 1/4 corner to W. Corner fits old corner fence post, fence remains N-S-E-W. Corner fence post destroyed by buried cable construction.
- 9 Reset well point that was lying on ground, equidistant & on line between found center of Sec. 12 to W & reestablished 1/4 corner to E. Corner falls in line with E-W fence remains to W, with highly irregular/intermittent wire in trees to south.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

L-3	8	9
Fd. 1"x48" pipe & cedar post w/loc. tag	Set 1 1/4"x22" rod & cedar post w/loc. tag	Well Point & cedar post w/loc. tag
14" Twin B.Cherry N13°W 30.93	5" Twin Maple Due S 63.83	12" Maple S08°W 18.30
12" Trpl.B.Cherry S26°E 83.10	7" R. Pine N36°E 45.92	16" B.Cherry N70°E 11.60
5" Maple S10°W 73.73	3" R. Pine N64°W 31.71	7" Maple N27°W 15.90
4" Maple S78°W 81.50		16" B.Cherry N89°W 15.90


SIGNED BY Carl F. Roser 4-28-77 DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

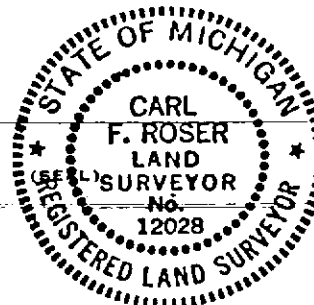

SURVEYOR'S MICHIGAN REGISTRATION NO. _____ CLEON TOWNSHIP
 MANISTEE COUNTY