

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

Manistee

(County)

Located in:

Corner Code #

- |                                    |                           |                    |
|------------------------------------|---------------------------|--------------------|
| 1. Public Land Survey              | T <u>24N</u> R <u>14W</u> | <u>I-05(SE 10)</u> |
|                                    | T _____ R _____           | _____              |
|                                    | T _____ R _____           | _____              |
|                                    | T _____ R _____           | _____              |
| 2. Property Controlling in Section | S _____ T _____ R _____   | _____              |
|                                    | S _____ T _____ R _____   | _____              |
| 3. Miscellaneous Property in Sec.  | S _____ T _____ R _____   | _____              |
|                                    | S _____ T _____ R _____   | _____              |

**REGISTER'S OFFICE**  
**MANISTEE COUNTY**

*95-453 at 10:00 AM*

**NOV 17 1995**

*Deborah Six*

**REGISTER OF DEEDS**

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_
5. Private Claims \_\_\_\_\_

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, Bruce J. Jenema on a field survey on September 13, 19 95, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:


Corner common to Sections 10,11,14 and 15 Established by John Brink D.S. 8-11-1839 page 101 Set post and witnessed by: Beech 12" S52°E 14 links  
 Beech 8" S42°W 18 links  
 J.H. Mallard June 30,1900 Found Cooks BT's Set Iron pipe and brick  
 Witnessed White pine stump 36" N6 1/2°W 26 links. Book B page 98, Book A page 26  
 LCRC 83-06 Carl F. Roser 5-02-1983 Found Railroad spike and replaced with  
 1 1/4"x 18" iron and witnessed: [1] 10" W. Pine N15°W 101.44'  
 [2] 15" W. Pine S60°W 61.04' [3] 16" Maple group S15°E 52.25'  
 "Fits 1955 MCRC witnesses"

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

MCRC witnesses 4-1983 same as [1] [2] and [3]  
 Undated MCRC witnesses 2" iron pipe [4] 12" Cherry NW 96.0  
 [5] 16" Maple S05°E 50.9'  
 On Sept. 13,1995 Found 1 1/4"x18" iron bar in centerline intersection of  
 Roads East-West and North Also found 3/8" wide flat piece of Iron stock  
 at a depth of 3.5' feet

Corner \_\_\_\_\_ ratified by the Manistee County Peer Group according to the county plan adopted pursuant to P.A. 345 of 1990, as amended, (being the State Survey and Remonument Act, MCL 54.261 et seq.) Date of Peer Review: NOV 7 1995

*Anthony M. Saunders*

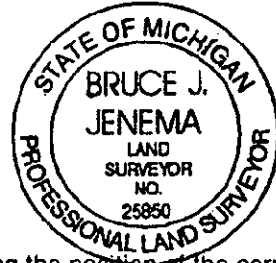

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

On Sept. 13,1995, Accepted 1 1/4"x18" iron bar as a careful and faithful re-establishment of the position of the original corner and installed a 2"x30" stainless steel pipe with a brass ID cap enclosed within a monument box and witnessed by:  
 [2] 15" W. Pine S60°W 61.08' Found 60-D Spike North side  
 [3] Group 16" Maple S15°E. 52.23' Found 60-D Spike Northwest side  
 8" Red Maple N25°E 80.90' Set 60-D Spike Northwest side  
 Utility Post N68°E 58.68' Found 60-D Spike Northwest side

Signed by Bruce J. Jenema

Date September 29, 1995

Surveyor's Michigan License No. 25850