


LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. PA 1970

For Corners In: <u>Manistee</u> (County)	Located In	Corner Code #
1. Public Land Survey	T _____ R _____ T _____ R _____	_____
2. Property Controlling in Section	S <u>34</u> T <u>24N</u> R <u>14W</u> 10 S <u>34</u> T <u>24N</u> R <u>14W</u> 11	
3. Miscellaneous Property in Section	S _____ T _____ R _____ S _____ T _____ R _____	_____
4. Lot No: _____	Recorded Plat: _____	
5. Private Claims: _____		

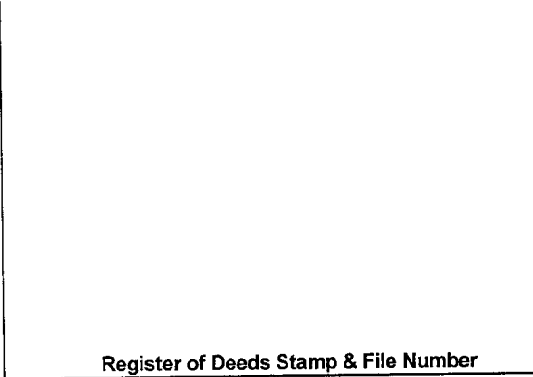

I, Craig W. McVean, in a field survey on Oct. 15, 2009 do hereby state that under requirements of PA 74, Michigan PA of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

10 – 1911 – CSR – L. 'A', p. 279 – J. H. Millard ? – Set 33 Survey – 11 – 1964 – T. J. Vaillencourt – Set iron pipe
Set stakes at every 40 acre corner but very few witnesses on account of lack of timber.
- 1964 – T. J. Vaillencourt – Set iron pipe

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

<p><u>10</u> – S 1/16 Corner common to Sec. 33 & 34 Set 2" Alum. Cap on 5/8" x 34" rebar per standard BLM procedure. Vaillencourt pipe is gone. E-W fence remains are 10'± South.</p>	<p><u>11</u> – SW 1/16 Corner Sec. 34 – Set 2" Alum. Cap on 5/8" x 34" rebar per standard BLM procedure. Set through old concrete floor of old building. Also found 3/4" iron pipe per Vaillencourt is S83°52'E 30.70' from '11'. Vaillencourt pipe based on rejected government corner position and was not accepted as '11'.</p>
---	--

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

<p><u>10</u> – Stamped 2" Alum. Cap on 5/8" x 34" rebar Set Blue Carsonite Post with loc. tag 1' NW S82°W 23.31' to set N & T in N. side 10" W. Pine S11°W 10.30' to set N & T in E. side Tw. 10" & 12" R. Maple N67°E 29.43' to set N & T in N. side 9" R. Maple N5°W 14.70' to set N & T in Tri. 19", 16" & 16" R. Maple</p>	<p><u>11</u> – Stamped 2" Alum. Cap on 5/8" x 34" iron rebar. Set Blue Carsonite Post with loc. tag 1' NW S83°52'E 30.70' to Fd. 3/4" iron pipe S73°E 16.15' to set N & T in S. side 12" W. Pine S43°W 30.94' to set N & T in NW side 4" R. Maple S88°W 46.14' to set N & T in S. side 12" W. Pine N23°W 21.24' to set N & T in W. side 6" W. Pine</p>
--	--

Signed by: Craig W. McVean
Surveyor's Michigan License No.: 39088

Date: 6/28/2010

