

SURVEY & REMONUMENTATION


JAN 23 2001

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners In: Located In: Corner Code #
Mason County

- 1. Public Land Survey T 17N R 15W K-10
T R
T R
T R
- 2. Property Controlling in Section S T R
S T R
- 3. Miscellaneous S T R
- Property in Sec. S T R
- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

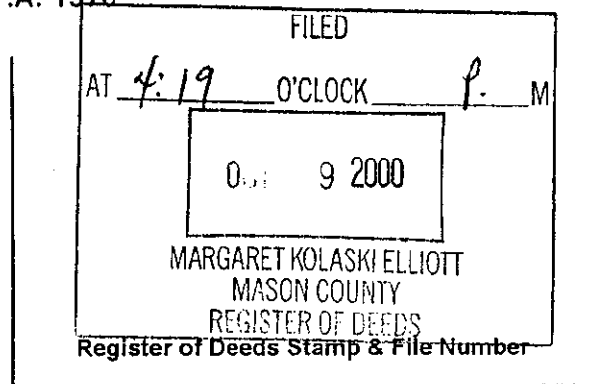

I, Theodore H. Weinert, in a field survey on September 3, 2000, Do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
Corner Common to Sections 25 and 26, T.17N., R.15W.,

Original Government Survey by Hodgson, 1838

(1) Pine, 18" for corner
No other witnesses given.

Book 1, Page 219, survey by W. Metcalf, 1889

"Pine Tree in good state of health" No witnesses given
(2) Corner K-9, T.17N., R.15W., North, 2732.40'

Book 2, Page 316, survey by R.E. Lunde, 1934

"Iron Pin in stones"

(2) Corner K-9, North 2709.10'

(3) Elm, 15", N90°W, 41.90'

(4) Corner K-11, T.17N., R.15W., South, 2650.80'

Kenneth L. Ross, PLS, 17634, survey Liber 1, page 376, October, 1975, "found 1 1/2" Pipe"

(8) Maple, 8", West, 26.21'

(9) Twin Maple, 10", NW, 39.36'

(10) Twin Elm, 18", SE, 34.14'

Mason County Road Commission Record, 1977

"1" pipe in place"

(5) Maple, 15", S75°W, 90.24'

(6) Maple, 6", N70°W, 88.88'

(7) Post, S70°E, 87.86'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
Corner Common to Sections 25 and 26, T.17N., R.15W.,

Found a 12" long bolt spike in a monument box, 0.5' West of the center-line of Masten Road. Witnesses (1), (5), (6), (7), (8), (9) and (10) have been destroyed. Witnesses (2) and (4) are in, but distances vary depending on date of survey. I found no other evidence to dispute the location of this corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
Corner Common to Sections 25 and 26, T.17N., R.15W.,

I replaced the 12" long bolt spike in the exact location with a 5/8" X 18" re-rod with the standard 2 1/2" aluminum disk stamped "Mason County Monument, 19846" inside the Monument Box. This corner accepted as a careful and faithful re-establishment of the original corner.

(2) Corner K-9, North, 2745.08' (Measured 9/2/00 EDM)

(11) Set 60d spike, SE Side of P.P., N25°E, 87.62'

(12) Set 60d spike, SW Side of P.P., S06°E, 223.08'


(13) Center of 3" diameter Steel Corner Chain Link Fence Post, S88°E, 44.35'

0.5' West of Center-line of Masten Road, Center-line of Drive to East, North, 10'

Signed by Theodore H. Weinert Date 10/6/00
Theodore H. Weinert

Surveyor's Michigan License No. 19846

Approved by Peer Review Group on 10/5/00
Kenneth L. Ross, County Representative [Signature]

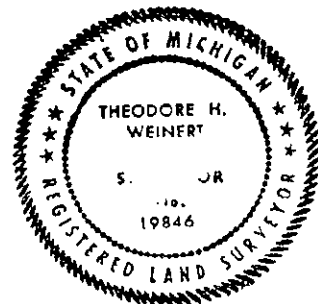

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983
ADAPTED FOR WORD PROCESSING MARCH, 1993