

SURVEY & REMONUMENTATION

JAN 23 2001

LAND CORNER RECORDATION CERTIFICATE

SECTION

Filing Requirement of Act 74, Mich. P.A. 1970

For corners In: Located In: Corner Code #
Mason County

Public Land Survey T 18N R 18W M-6
T 18N R 17W A-6 ✓
T R
T R
Property Controlling S T R
in Section S T R
Miscellaneous S T R
Property in Sec. S T R

FILED
AT 9:33 O'CLOCK A M
AUG 11 2000
MARGARET KOLASKI ELLIOTT
MASON COUNTY
REGISTER OF DEEDS
Register of Deeds Stamp & File-Number

Lot No. Recorded Plat
Private Claims

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

Kenneth L. Ross in a field survey on June 14, 2000, Do hereby certify that under requirements of P.A.74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: 1/4 corner common to section 18 of T18N, R17W, and Section 13 of T18N, R18W

Description of original monument and accessories and/or subsequent restoration:

- lullett & Brookfield
1/4 sec. post is a pine 14"
no witnesses taken. Fluharty PLS 18223 Liber 1 page 315
Fd. 1" iron in mon. box
PP S40E 55.50' #1
PP N35E 48.78' #2
Support Pole N35W 60.54' #3
- Stephens RLS 7318, June 1954
existing concrete monument
no witness taken. Hooth RLS 7966 Jan. 27, 1977 L1 P319 Act 74
1" pipe in Mon. Box in intersection
PP N35E 48.81' #2
TP N35W 60.55' #3
TP S35W 39.50' #5
PP S40E 55.51' #1
- E Mitchell 1883 B1 P140 1883
bump to Govt. wit. trees
loss RLS 17634, iron in mon. box. Act 74
liber 1 page 253
no witnesses taken. MCRC undated
PP N43W 58.4' #7
30' Elm S54E 31.9' #8
TP S33W 38.5' #6


1. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

found a 1" iron in a monument box in the center of the turn lane.
Witness 1 through 8 inclusive were gone.
found nothing to dispute the location of this corner.

2. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

left the 1" pipe in the monument box intact and accepted this as careful and faithful reestablishment of the position of the original corner. No additional monumentation was added.
P N58W 208.06' 16d nail and tag (Beebe) 39074 on S side
P N29E 77.39' 16d nail and tag (Beebe) 39074 on E side
P S39W 72.31' 16d nail and tag (Beebe) 39074 on NW side
fire hyd. Top center S55W 83.36'

Signed by [Signature] Date 8-10-2000
Surveyor's Michigan License No. 17634

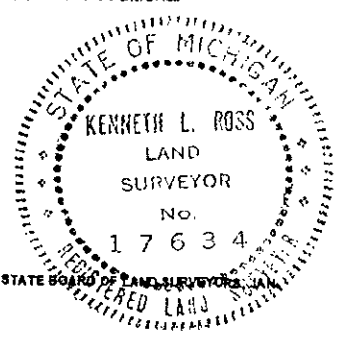

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN 1983

Approved by Peer Review Group on 8-10-2000
Kenneth L. Ross, County Representative [Signature]

28.
REVISED MAY 14, 1976
REVISED JAN., 1983
ADAPTED FOR WORD PROCESSING MARCH, 1983