

SURVEY & REMONUMENTATION

JAN 28 2001

SECTION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

FILED
 AT 9:47 O'CLOCK A M
 AUG 17 2000
 MARGARET KOLASKI ELLIOTT
 MASON COUNTY
 REGISTER OF DEEDS

Register of Deeds Stamp & File Number

For corners In: Located In: Corner Code #
 Mason County

- 1. Public Land Survey T 18N R 18W I-11
- 2. Property Controlling in Section S T R
- 3. Miscellaneous Property in Sec. S T R
- 4. Lot No. _____ Recorded Plat _____
- 5. Private Claims _____

I, Kenneth L. Ross in a field survey on July 25, 2000, Do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

Section corner common to section 26, 27, 34 and 35 of T18N, R18W

A. Description of original monument and accessories and/or subsequent restoration:

- GLO Sibley 1838 30" pine N44W 25 links (16.5') #1 10" Beech S75E 12 lks (7.92') #2
- MCRC (undated) 1/2" iron Conc. Mon. North 33' #3 12" Maple N 15 1/2E 47.8' #4 14" Beech N 25deg 12' E 41' #5 Iron S. 33' #6
- Stephens RLS 7318 unrecorded 1959 Ex. concrete monument No witnesses (indicates on drawing that he set a Conc. mon. 33' North and a 1/2" pipe 33' South.)
- Ross RLS 17634 unrecorded 1999 Ex. iron in mon. box No witnesses
- Floharty RLS 18223 L342 P89 Fd. spike in mon. box PP North 40.10' #7 SE cor. fence N50W 106.5' #8 PP N40E 55.60' #9


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found a 1" solid iron in a monument box 1.5' North of the centerline of Iris Road. I left the 1" solid iron intact.
 The condition of the accessories are as follows: 1,2,4,5,8 and 9 are gone. 3,6 and 7 are in good condition.
 I found nothing to dispute the location of this corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I found a 1" solid iron in a monument box 1.5' North of the centerline of Iris Road. I left the 1" solid iron intact. I accepted this as a careful and faithful reestablishment of the position of the original corner.
 1/4" iron pipe S00E 33.23' #6
 Concrete monument N00E 33.07' #3
 PP N00E 39.96' #7
 Center of 2" diameter x 4' high corner fence post N48E 53.51'

Signed by [Signature] Date 8-10-2000
 Surveyor's Michigan License No. 17634

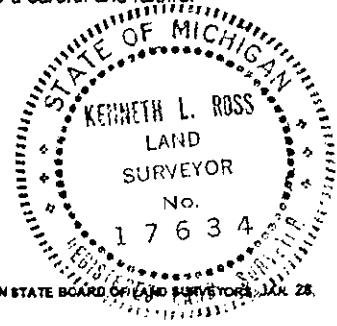

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28,

Approved by Peer Review Group on 8-10-2000
 Kenneth L. Ross, County Representative

1971
 REVISED MAY 14, 1978
 REVISED JAN., 1983
 ADAPTED FOR WORD PROCESSING MARCH, 1993