

**SURVEY &
REMONUMENTATION**

JAN 23 2001


LAND CORNER RECORDATION CERTIFICATE

SECTION

Filing Requirement of Act 74, Mich. P.A. 1970

For corners In: Located In: Corner Code #
Mason County

1. Public Land Survey	T 17N	R 18W	I-1
	T 18N	R 18W	I-13 ✓
	T	R	
	T	R	
2. Property Controlling in Section	S	T	R
	S	T	R
3. Miscellaneous Property in Sec.	S	T	R
	S	T	R

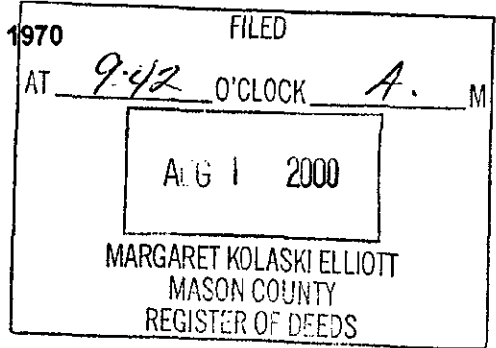

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Kenneth L. Ross in a field survey on July 21, 2000, Do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

Section corner common to sections 34 and 35 of T18N, R18W, and sections 2 and 3 of T17N, R18W.

A. Description of original monument and accessories and/or subsequent restoration:

- | | |
|---|---|
| GLO Mullett and Brookfield 1838
12" Hemlock N76E 23 lks. (15.18') #1
5" Beech N63W 16 lks. (10.56') #2 | Fluharty RLS 18223 L337 P792
fd. 1/4" iron in mon. box 6' south of center of rd.
18" maple S64E 54.79' #3
PP S28E 22.95' #7
PP N10E 28.29' #8 |
| MCRC 1971 J. Borsfay
Fd. 1/2" iron rod on surface lowered 4"
set mon. box
Conc. mon. Consumers Power Co.
South 32.91' #3
10" W. oak NE 70.95' #4
iron on Lakeshore Dr. West 1234.21' #5 | |


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found 1/4" X 13" iron rod in a monument box 6' south of centerline of E-W rd.
The condition of the accessories are as follows: 1 and 2 are gone. 3 is good. 4 is good but the tree species is a maple. 5, 6, 7 and 8 are in good condition.
I found nothing to dispute the location of this corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I replaced the 1/4" X 13" iron rod with a Harrison Monument in a monument box stamped "Mason County Monument PLS 17634". I accepted this as a careful and faithful reestablishment of the position of the original corner.

- Guy pole S27E 23.15' (set 60d spike on W. side) #7
- Power pole N11E 28.32' (MSHD shiner & 16d nail on E. side) #8
- 13" Maple S64E 54.83' (set 60d spike on S. side) #3
- 16" Maple S74W 62.33' (set 60d spike on N. side)

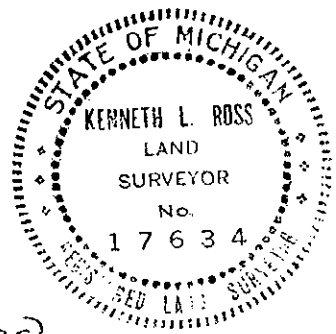

Signed by [Signature] Date 8-10-2000
Surveyor's Michigan License No. 17634

Approved by Peer Review Group on 8-10-2000
Kenneth L. Ross, County Representative [Signature]

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28,

1971
REVISED MAY 14, 1978
REVISED JAN, 1993
ADAPTED FOR WORD PROCESSING MARCH, 1993