

**SURVEY &
REMONUMENTATION**

APR 28 1995

COMMISSION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

FILED
AT 11:10 O'CLOCK a

OCT - 7 1994

MARY GOLDEN KOLASKI
MASON COUNTY
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

For corners in

<u>MASON</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T 19 N R 15 W	L-13
	T R	
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

I, Sammy S. Barnett, in a field survey on September 20, 1994, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	13	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

A. Description of original monument and accessories and/or subsequent restoration:

L-13 South 1/4 corner, Section 36, on the Township Line

1838, G.L.O., John Mulette

Set wood post

- #1 W. Pine 15" N 36° W 311k(23.76')
- #2 W. Pine 24" N 70° E 331k(21.78')

1971, Robert A. Griffin P.S. 13584

Found no corner, set by single proportional method
Set conc. monument

- #3 Maple 6" N 49° E 126.95' #7 4" x 7' Pine Post
- #4 W. Oak 5" N 59° E 116.30' N 21° W 83.95'
- #5 Tamarack 7" N 21° W 83.95'
- #6 Center of the Monument for the N. 1/4 cor. Sec. 1 T18N,R!

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

L-13 South 1/4 corner, Section 36, on the Township Line

On September 20, 1994, I found part of U.S.F.S. concrete Monument lying along side of Road, marker had been remove from its original position, replaced with a 1/2" x 24" Re-rod with an aluminum cap, stamped Mason County Monument, set by recorded witnesses 1 foot below Road surface. Condition of recorded witnessess is;
#1 Gone #2 Gone #3 Found in good cond. #4 Found in good cond. #5 Found in good cond. #6 Found with 3" brass cap broken off. #7 Gone


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

L-13 South 1/4 corner, Section 36, on the Township Line

Set ~~4 1/2"~~^{5/8"} x 24" Re-rod 5/8" in dia. with 2 1/2" aluminum cap, stamped Mason County Monument for the corner, and is accepted as a careful and faithful reestablishment of the position of the original corner.

- (OBT #3) Maple 10" N 49° E 126.95' (10" dock spike in NW side of tree)
 - (OBT #4) W. Oak 5" N 59° E 116.30' (10" dock spike in NW side of tree)
 - (OBT #5) Tamarack 7" N 21° W 83.95' (10" dock spike in NE side of tree)
- Center of 5" square concrete monument (brass cap remove) 7.26' East

Signed by Sammy S. Barnett Date 10/4/94
Surveyor's Michigan License No. 16923

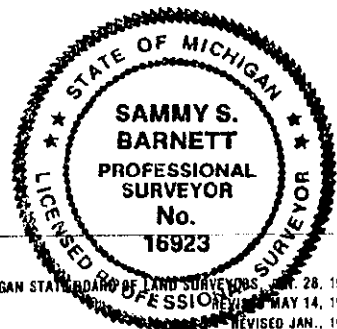

Peer Group Reviewed and Approved
Date: 10-5-94
Kenneth L. Ross
Mason County Surveyor

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, MAY 14, 1978, REVISED JAN., 1988

LIBER 3PAGE 185