

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A., 1970

For corners in

Monroe
(County)

Located In: Corner Code #

- 1. Public Land Survey T 5S R 10E C-11
- 2. Property Controlling in Section
- 3. Miscellaneous Property in Sec.
- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

REGISTER OF DEEDS
MONROE COUNTY, MICH

RECEIVED FOR RECORD
99 DEC 28 AM 8:38

Register of Deeds Stamp & File Number

1999 Remonumentation Private Corner

I, David A. Andrus, in a field survey on September, 19 99 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and / or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- GLO: Fletcher in 1817 set post and witnessed: Hickory 16' N 78 W 15 Links; Sycamore 16' S 11 W 15 links
- 1896: Winney surveyed Sec. 32 showed corner but did not identify. Gave one witness: NE 0.56 chains straight rail fence corner.
- 1954: Sketch by Marino shows stone and provides witness: SW 54.2' to nail in tree; NW 36.5 to fence post WNW 51.5' to nail in tree; SE 35.15' to street name post; East 319.05' to C-L DTSL R/R
- 1985: George Warnke in LCRC Liber 3, Page 010 found 5/8" iron pipe and provided 4 witnesses:
N 20 W 41.8' to W. End 12" culvert
N 20 E 44.05' E. End 12" culvert
S 30 E 54.2' to E. End 12" culvert
S 45 W 61.8' to S End 18" culvert

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

September 24, 1999, D.A. Andrus found 5/8" iron pipe at surface. Excavated down 18" and found that pipe was driven over a 1/2" pipe. Continued digging and did not find stone as deep as 36". Corner is near the approach to R/R crossing and is at least 4 feet higher than the natural grade. Pipe as found is 318' from the C-L of the DTSL R/R. All other Marino witnesses were gone. Surviving Warnke witnesses still fit pipe. Placed a 1" pipe with a brass remonumentation cap in a monument box over the position of the pipe. The Peer Group has accepted this location as the best available evidence of the position of the corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


Set brass remonumentation cap on a 1" pipe in a monument box and witnessed:

- N 45°W 41.75' to W. End 12" conc pipe
- N 45°E 44.10' to E. End 12" conc pipe broken
- N 20° W 29.52" to road sign
- S 86° E 379.24' to federal benchmark Z-179

Signed by

David A. Andrus

Surveyor's Michigan License No. 40155

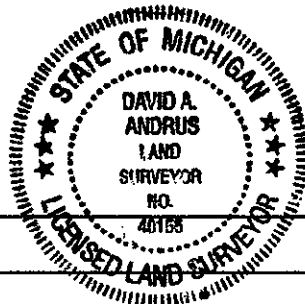

RATIFIED BY PEER GROUP
PA 345 OF 1990
MONROE COUNTY, MICHIGAN

date: 10/12/99
County Rep.: *[Signature]*

Date October 29, 1999