

date: 8/10/1995 **LAND CORNER RECORDATION CERTIFICATE**
County Rep.: [Signature] **Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in	Located In:	Corner Code #
<u>Monroe (58)</u> (County)		
1. Public Land Survey	T ___ R ___	___
<u>Whiteford Twp.</u>	T <u>8S</u> R <u>6E</u>	<u>F-4</u>
	T ___ R ___	___
	T ___ R ___	___
2. Property Controlling	S ___ T ___ R ___	<u>SURVEY &</u>
in Section	S ___ T ___ R ___	<u>REMONUMENTATION</u>
3. Miscellaneous	S ___ T ___ R ___	___
Property in Sec.	S ___ T ___ R ___	___

RECEIVED FOR RECORD
95 DEC 28 AM 9:05
REGISTER OF DEEDS
MONROE COUNTY, MICHIGAN
[Signature]
Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____ **COMMISSION**

APR 04 1996

	A	B	C	D	E	F	G	H	I	J	K	L
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

1995 REMONUMENTATION PROGRAM

I, G.B. WARNKE, JR., in a field survey on Aug. Oct., 1995, 19____, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

Center of Section 9 / in U.S. 223 - hard surface.
Not set by GLO.
A.J. Marino notes show that SET 5/8" x 30" REROD - MSHD - Nov '74 by Mich State Highway Dept.
1975, M.R. Fleck survey states FD. 5/8" IRON ROD.
1978 to present, G.B. Warnke survey FOUND IRON PIN IN MONUMENT BOX.


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

8/10/95 - Found iron pin in monument box. 8/10/95 - corner was peer group approved.
10/25/95 - Set 1" x 36" iron pipe with brass remonumentation cap in existing monument box.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 1" x 36" iron pipe with brass remonumentation cap in existing monument box. This position not established by original government surveyors. This monument is accepted as the best available evidence of the position of the corner and witnesses:
South 20° East 32.07 feet to "+" in station 885+00, +/- 1' north of south edge of pavement
South 22.38 feet to 1/2" iron pipe at surface of concrete pavement
North 15° West 47.11 feet to post at east end of gate
South 2.0 feet to north edge of pavement of U.S. 223

Signed by [Signature] Date 12/19/1995
Surveyor's Michigan License No. 19474

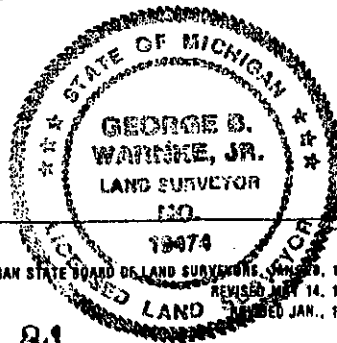

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, REVISED JAN. 14, 1988

① F-4 (8/6) WHITEFORD