


MAY 20 1997

COMMISSION

RECEIVED RECORDS

96 DEC 13 PM 3:19

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A., 1970



For corners in

<u>Monroe</u> (County)	Located In:	Corner Code #
	<b>Whiteford Twp.</b>	
1. Public Land Survey	T <u>8S</u> R <u>6E</u>	<u>H-11</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

I, Bruce Antcliff, in a field survey on July 19 96 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and / or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

Monroe County Road Commission Corner

A. Description of original monument and accessories and/or subsequent restoration:

Quarter corner common to sections 27 & 34, T8S, R6E, Whiteford township / Sterns Road @ US-23, Asphalt over stone, not in road 1820, GLO Surveyor Wampler set wood post; Aspin 14", S46E, 52 links; Aspin 11", South, 79 links 1956, MDOT Project #58034, sheet 10, witnesses to N1/4 corner (monument not described); N50E, 53.76', telephone pole; S45E, 46.66', 30" elm; N38W, 35.95', fence corner post 1972, M.Freels, found mon. box, same witnesses as MDOT 1978, M.R.Fleck, found monument; East, 58.3', cross in guard post; N35E, 68.3', cor. guard post; S15W, 4.5', guard rail support 1983, G.B.Warnke, found iron in mon. box 1987, G.B.Warnke, found monument; South, 1.4', guard rail; N80E, 38.5', NW cor. CB; N55E, 49.4', SW cor. CB

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:


Found iron in monument box in dirt shoulder, south side of Sterns Road, 15" below surface. Witnesses check with 1987 G.B.Warnke above. Corner is on overpass over US-23 and all evidence of original corner would have been destroyed during construction. Therefore no excavation of corner was done.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Raised monument box to just below surface and set 1"x36" iron pipe with brass remonumentation cap inside monument box to replace iron and is accepted as the best available evidence of the position of the original corner.

Witnesses:  
N45E, 50.58', NW corner of C.B. rim  
N85E, 38.40', NW corner of C.B. rim  
South, 3.72', Chiseled "+" in north face of steel guard rail post  
S85W, 63.31', Chiseled "+" in top east end of conc. curb @  
US-23 south bound entrance ramp

RATIFIED BY PEER GROUP  
PA 345 OF 1990  
MONROE COUNTY, MICHIGAN  
date: 9/24/1996  
County Rep.: \_\_\_\_\_

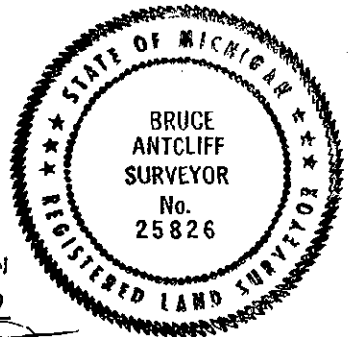

Signed by Bruce Antcliff

Date 11-26-96

Surveyor's Michigan License No. 25826