

SEP 12 1995

COMMISSION

MONTCALM COUNTY REMONUMENTATION PROGRAM
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in Montcalm (County) Located In: Corner Code #
1. Public Land Survey Sec 6 T 10 R 6 B-1, N 1/4
2. Property Controlling in Section S T R
3. Miscellaneous Property in Sec. S T R
4. Lot No. Recorded Plat
5. Private Claims

STATE OF MICHIGAN
MONTCALM COUNTY
RECORDED
10 AUG 95 3:33 P.M.
VIRGINIA L. KNEPPER
REGISTER OF DEEDS
Register of Deeds Stamp & File Number

Table with 13 rows and 12 columns (A-M) containing numbers 1-36 in a grid pattern.

I, William Tingley a field survey on March 9, 1995, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

Not a GLO Corner
1905, J.F. Daoust

Reestablished 40.23 chains from Northeast Section Corner and 40.37 chains from Northwest Section corner and on line between same

drove square spike 16" long

1925, Michigan State Highway Department Plans, Trunkline 43, Project 5

1/4 Corner Section 6, gaspipe

Also Iron Bolt

Notch in Stump Fence N05°W 34.5 feet

Notch in Stump Fence South 27.8 feet

June 15, 1940, R.D. McNutt, Index Cards

Found iron bolt and brought to surface with wood stake: Southeast corner of South headwall Southwest 47.35 feet

Maple 10" Southeast 95.5 feet

Maple 4" Northeast 43.0 feet

Birch 6" Northeast 43.0 feet

(Also on card - buggy axle?, notch in pine stump on North and South fence line South 27.8 feet)

Old witness date and surveyor unknown, found in Court House

Buggy Axle, notch in Pine Stump on North south fence line due South 27.8 feet

Notch root pine fence N05°W 34.5 feet

1963 Michigan State Highway Department

Found Railroad spike 135.35 feet East of Southeast Corner, Section 31, 11-6

January 7, 1991, W.G. Tingley, #30104, Survey

Found Railroad Spike West 135.37 feet

Found Capped Iron South 33.0 feet

Southerly leg City limit sign N40°W 30.75 feet

Set Nail Northside 22" Maple S45°E 95.89 feet

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found Railroad spike on tree row to South 135.37 feet East of Section 31 and 32, South Boundary of T11N-R6W.

Agrees closely with J.F. Daoust's 1905 distances to the Northwest corner of Section 6 and to the Northeast corner Section 6, the measured distances being 2667.34 and 2656.89 feet respectively

Found 10" Maple (now 22") S45°E 95.5 feet

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set Remonumentation Corner in place of Railroad Spike on fence South

Capped Iron South 33.00 feet

Southerly leg City Limit Sign N40°W 30.75 feet

Set Nail Northside 22" Maple S45°E 95.89 feet

"No Passing" sign post S60°W 80.80 feet

This corner is accepted as a careful and faithful perpetuation of the position of the original corner.

Signed by William Tingley Date April 19, 1995


Surveyor's Michigan License No. 30104

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971

REVISED MAY 14, 1975

REVISED JAN., 1983

ADAPTED FOR WORD PROCESSING MARCH, 1993

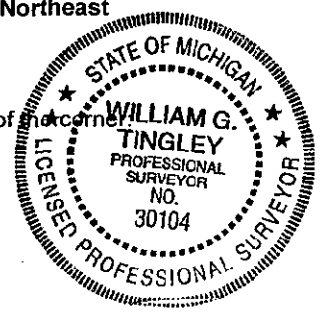

ACCEPTED BY THE MONTCALM COUNTY SURVEY FEE GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1990 AT A MEETING HELD 3/14/95
William Tingley, PS, Chairman