

**MONTCALM COUNTY REMONUMENTATION PROGRAM**

**LAND CORNER RECORDATION CERTIFICATE**

Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

For corners in  
Montcalm  
 (County)


Located In: Sidney Township

Corner Code #

1. Public Land Survey	Sec	T <u>10N</u>	R <u>7W</u>	<u>I-1, N. Boundary</u>
		T _____	R _____	_____
		T _____	R _____	_____
		T _____	R _____	_____
2. Property Controlling in Section	S	T _____	R _____	_____
	S	T _____	R _____	_____
3. Miscellaneous Property in Sec.	S	T _____	R _____	_____
	S	T _____	R _____	_____

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

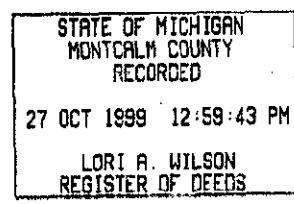

Register of Deeds Stamp & File Number

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, William Tingley a field surveyor on June 97 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

**A. Description of original monument and accessories and/or subsequent restoration:**

- 1838, Noah Brookfield, Deputy Surveyor, GLO Notes  
76.50 chains: Correction line. Set post corner of Sections 2 and 3.  
Pine 18" S6°W 30 links  
Beech 12" S57°E 23 links
- 1879, H. Caukin, County Surveyor, from R.D. McNutt's witness cards  
Pine Stump 26" N16-1/2°E 26-1/2 links
- 1907, John Daoust, County Surveyor, Liber 3, page 308  
Found stake bottom agreeing with improvements  
Same is 3.24-1/2 (chains) East of South 1/4 Post of Section 35-11-7. Drove gas pipe and root stake  
Notch on Stump in fence N5°W 46-1/2 links
- 1912, E. Youdan, County Surveyor, from R.D. McNutt's Index Card Records  
Maple 5" S48°E 40 feet
- 1939, Road Plans for C-522, Federal Project FAS 272 C1  
Iron Rod 5.15 feet Right of Centerline  
Maple 12" S48°E 40 feet  
Notch on Stump N05°W 30.7 feet
- 1960, G.M. Stevenson, Jr. #31300 from Card File Records  
Apple 4" S05°W 50.9 feet  
Apple 4" S32°W 57.7 feet  
4.35 feet North of Centerline of Pavement
- 1969, R.J. Crater #16924, Same Source as above  
Found Fire Clay Monument raised with 1/2" Rod  
Power Pole Northeast 100.15 feet  
East End Drive Culvert North 18.60 feet

Continued on Back .....

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

- Found 1/2" Rod, 5.2 feet South of Centerline of Road. 2625.80 feet West of North 1/4 Corner (record highway 1939 - 2626.55 feet)  
Found 2" pipe in Concrete (0.6 feet x 1.0 feet) S45°W 40.25 feet  
Found Nail in Power Pole S45°E 65.91 feet

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

- Set Remonumentation Corner over 1/2"  
Found Spike in West Side Power Pole S50°E 66.10 feet  
2" Pipe (Set in Concrete 0.6 feet x 1.0 feet) S45°W 40.35 feet  
Street-Stop Sign Post S35°E 44.6 feet  
Easterly Leg Arrow Sign North 29.82 feet

This corner is accepted as the best available evidence of the position of the original corner.

Signed by William G. Tingley Date 12-10-97, 1997

Surveyor's Michigan License No. 30104



ACCEPTED BY THE MONTCALM COUNTY SURVEY PEER GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1990 AT A MEETING HELD 12/10/97.

WGT  
William Tingley, PS, Chairman



Continued from Front (I-1, 10-7)

1992, William Tingley, #30104 from Job 92306

Corner Sheet, Found 1-1/2" Solid Iron

Found Nail in South side Power Pole

2" Iron Pipe in Concrete

Easterly leg of Road Sign

Centerline of East-West Road

Located on Centerline Gravel Road South

S45°E	65.91 feet
S45°W	40.25 feet
N10°W	29.65 feet
North	4.80 feet

SURVEY &  
REMONUMENTATION

1992

SECTION



F4 161 39

LIBER 4

PAGE 161