

REC'D JAN 10 10

JAN 20 2000


SECTION

MONTCALM COUNTY REMONUMENTATION PROGRAM
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in Montcalm (County) Located In: Cato Township Corner Code #

1. Public Land Survey	Sec	T 12 NR 8W	A-7
		T 12 NR 9W	M-07
		T R	
		T R	
2. Property Controlling in Section	S	T R	
	S	T R	
3. Miscellaneous Property in Sec.	S	T R	
	S	T R	

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

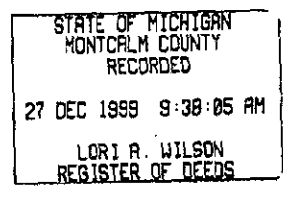

Register of Deeds Stamp & File Number

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7	19	20	21	22	23	24							
8													
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, William Tingley a field survey on December 11, 1996, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
1837, John Hodgson, Deputy Surveyor, GLO Notes
Set Post Corner Sections 13 and 24
Lynn 16" S39°W 27 links
Lynn 18" N48°W 44 links
R.D. McNutt, County Surveyor, Index Card File
April 1869, Stone 36" long, 6" x 6" at top and 8" x 8" in middle

ACCEPTED BY THE MONTCALM COUNTY SURVEY PEER GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1990 AT A MEETING HELD 6/29/99

WOT
William Tingley, PS, Chairman

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
Found 1 1/2" x 20" Iron Pipe in Monument Box Twenty Four inches below road surface under Iron Pipe found 1" x 20" solid iron. Immediately below 1" iron found 1 1/2" Solid Iron (3.5 feet below surface). 1 1/2" Iron was set against the East Side of a long stone.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
Set Remonumentation Monument over Irons and Stone in Monument Box
Set Nail and Tag North Side Power Pole S45°E 53.14 feet
Set Nail and Tag North Side Telephone Pole S40°W 62.78 feet
Set Nail and Tag East Side Wood Post N45°W 87.89 feet
Northerly Leg Road Sign West 27.70 feet

Signed by William Tingley Date 22 Dec., 1999
Surveyor's Michigan License No. 30104

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983
ADAPTED FOR WORD PROCESSING MARCH, 1992

