

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Marquette

(County)

Located In:

Corner Code #

1. Public Land Survey

T 44N R 26W

A5

T _____ R _____

T _____ R _____

T _____ R _____

2. Property Controlling
in Section

S _____ T _____ R _____

S _____ T _____ R _____

3. Miscellaneous
Property in Sec.

S _____ T _____ R _____

S _____ T _____ R _____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

Jun 14 2001

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

(A5) Corner common to Sections 12-13 T44N-R27W and 7-18 T44N-R26W. Reestablished in 1950 by Dean C. DeLaMater RLS: "This corner was established by proportionate measurement by forestry division Survey crew while working in this area. One probable B.T. still in place, but badly rotted. 1" Pipe with 4" brass cap. 12" Spruce S70E 28 links, 12" Spruce S3W 23 links, 14" Spruce N80W 63 links."

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner.

(A5) Recovered the 1950 monument as described, in good condition, and at record bearing and distance from the decaying remains of the SE and NW spruce witnesses, both down but with scribing visible. The SW spruce is not evident. Also found old decaying spruce post and tan. post point at corner. Left the monument in place and marked new witnesses as described below.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner.

(A5) Found 1" ID iron pipe with 4" brass

MDOC cap. Blazed and scribed:

5" B. Spruce N28E 19.7' "S7 NBT"

6" B. Spruce S47E 18.6' "S18 NBT"


7" B. Spruce S32W 26.1' "S13 NBT"

6" B. Spruce N32W 29.0' "S12 NBT"

Sq'd cedar post adjacent. Bearings are

magnetic. Distances are to notch in

lower blaze.

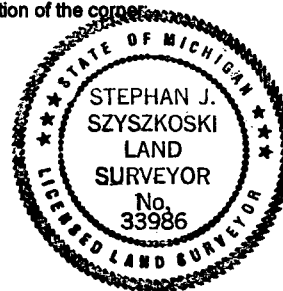

Signed by

Stephan J. Szyszkoski

Date

8/8/01

Surveyor's Michigan License No.

33986

For the Michigan Department of Natural Resources - Forest Management Division