

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Marquette
 (County)

Located in: _____ Corner Code # _____

1. Public Land Survey
 T ___ R ___
 T ___ R ___
 T ___ R ___
 T ___ R ___

2. Property Controlling in Section
 S 10 T 45N R 30W 6
 S 10 T 45N R 30W 12

3. Miscellaneous Property in Sec.
 S ___ T ___ R ___
 S ___ T ___ R ___

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

12 Oct 09 2001
 6 Oct 17 2001

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
 (6-Sec. 10) Northeast 1/16 corner, Section 10. Not established in the original survey.
 (12-Sec. 10) South 1/16 corner. Not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(6-Sec. 10) Established the corner at the intersection of straight lines connecting opposite 1/16 corners. From the position thus established, I found a 1/2" dia. rebar encased in a 4" dia. concrete cylinder, not of record, N04W 14.4' distant, which I did not accept for the corner.


(12-Sec. 10) Found a 1" ID iron pipe capped with a 4" dia. alum. Kimberly-Clark Corp. cap, stamped to identify the corner but without date or Surveyor's Registration Number. Records at the local International Paper Co. office do not include any information on this monument nor any indication that a Kimberly-Clark or International Paper Co. surveyor ever worked inside Section 10. My survey of this section shows that this monument does not fit with any regular subdivision of this section and I conclude that it is in an erroneous location. I measured N 35° W 1297.29' to the monumented center of section and S 23° E 1333.96' to the monumented South 1/4 of Section 10 (true bearings). I did not monument the proper 1/16 corner location at this time. This record is being filed as a public notice.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(6) Set 1" ID x 32" I. Pipe with 4" alum. MDNR cap. Blazed and scribed:
 11" Sugar N27E 17.8' "1/16S 8T"
 13" Sugar S06E 23.1' do
 7" Sugar N87W 23.7' do
 7" Sugar N45W 11.3' do

(12) See Part B, above. I did not monument the proper corner location at this time. This record is being filed as a public notice.

Set sq'd cedar post adjacent. Bearings are magnetic. Distances are to notch in lower blaze.

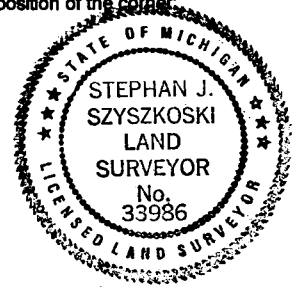

Signed by Stephan J. Szyszkoski Date 2/4/02
 Surveyor's Michigan License No. 33986

For the Michigan Department of Natural Resources - Office of Property Management