

LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970

Alan Davis RLS
 Chairman

For corners in
MENOMINEE
 (County)

Located In: Corner Code #

1. Public Land Survey T33N R. 27W K-6
 T R
 T R
 T R

2. Property Controlling in Section S T R
 S T R
 S T R

3. Miscellaneous Property in Sec. S T R
 S T R

RECEIVED FOR RECORD
 95 DEC 27 PM 3:28
 PAGE # 264
 BARBARA MCGREGOR
 REGISTERED DEEDS
 MENOMINEE COUNTY

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

1	A	B	C	D	E	F	G	H	I	J	K	L
2		6		5		4		3		2		1
3												
4		7		8		9		10		11		12
5												
6		13		17		16		15		14		13
7												
8		19		20		21		22		23		24
9												
10		30		29		28		27		26		25
11												
12		31		32		33		34		35		36
13												

I, William Lenca, in a field survey on Oct. 13, 1995 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:


- 1848: Original Survey by James H. Mullett - B.T.'s - B. Ash, 6" - S59°E - 2 lks; Cedar, 6" - N59°W - 3 lks. All original evidence has been destroyed by farming activities.
- 1983: Certified Survey No. 371, recorded by George B. Wilson, RLS No. 17607, shows this corner position established on line and midway between the NE and SE Corners of Section 14, T33N-R27W. No corner monument is shown or described, and no ties are given.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

In our 1995 Remonumentation Survey in T33N-R27W, we located a position on line and midway between the NE and SE Corners of Section 14, T33N-R27W, as indicated in Certified Survey No. 371. The corner falls in the middle of a large farm with no occupation evidence at the corner location. We therefore accepted the single proportioned position as a careful and faithful reestablishment of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
 Set 2" dia. Aluminum Pipe/3-1/4" dia. Alum cap stamped for corner location:

16" dia. Elm	N74°E	11.96 feet	Scr. NBT
12" dia. Elm	S04°E	10.60 feet	Scr. NBT
12" dia. Hemlock	S74°W	3.23 feet	Scr. NBT
8" dia. Elm	N09°W	40.44 feet	Scr. NBT
Metal Survey Sign Post	N58°E	1.1 feet	

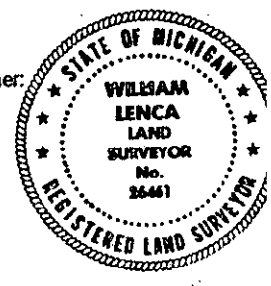

NOTE: All bearings are magnetic bearings. All distances are measured with a steel tape. Distances to trees are to nail in side of tree.

Signed by William Lenca Date Nov. 27, 1995
 Surveyor's Michigan License No. 26461