

SURVEY & REMONUMENTATION

OCT 26 1993


COMMISSION

Approved by Menominee County
Land Survey Remonumentation
Peer Group Under Act 345 Of
P.A. Of 1990 On Oct 6 1993
McC. Davis PLS
Chairman (ACTING)

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>MENOMINEE</u> (County)	Located In:	Corner Code <u>11</u>
1. Public Land Survey	T <u>34N</u> R <u>25W</u>	<u>B-3</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

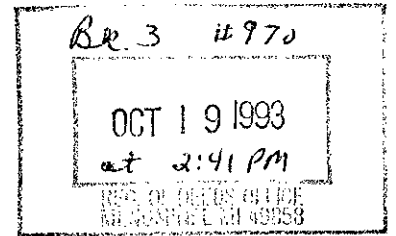

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	N
2	6		5		4		3		2		1		
3		●											
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, William Lenca, in a field survey on August, 1993, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

ORIGINAL B.T.'s

- Tamarack, 8", S87°E, 4 lks
- Tamarack, 10", N80°W, 5 lks

Original Survey by James H. Mullett in 1848. All original evidence for this corner has been destroyed by county road improvements.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

The Single Proportioned position for this corner was searched, as well as the position of the intersection of County Road centerlines running North, East and West from this location. No evidence was found at either location, however the position of the county road intersection fits closely with occupations 1/4 mile East and West of this position. Accepted the position of the intersection of the County Road intersections as the best available evidence of the position of the original corner.



C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 2 1/2" x 30" Alum. Cone Monument/3 1/4" Alum. cap stamped for corner:

- 5" dia. Cedar S31°E 47.12 feet
- 16" dia. Cedar S63°W 64.14 feet
- 5" dia. Cedar N45°W 55.76 feet
- 5/8" x 24" Iron Rod/2" Alum. cap marked WITNESS MARKER @ Steel Sign Post - S03°W - 29.67'

NOTE: All bearings are magnetic bearings; all distances are measured with steel tape; distances to trees are to nails in center of tree.

Signed by William Lenca
Surveyor's Michigan License No. 26461

Date Sept. 30, 1993