

FEB 11 1998

Approved by Menominee County  
Land Survey Remonumentation  
Peer Group Under Act 345 Of  
P.A. Of 1990 On 12/18 1997  
Mc Lewis PCS  
Chairman

SECTION

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in  
MENOMINEE  
(County)

Located In:	Corner Code #
T <u>34</u> N R <u>27</u> W	<u>M-04</u>
T <u>34</u> R <u>26</u> W	<u>A-04</u>
T <u>   </u> R <u>   </u> W	<u>   </u>
S <u>   </u> T <u>   </u> R <u>   </u> W	<u>   </u>
S <u>   </u> T <u>   </u> R <u>   </u> W	<u>   </u>
S <u>   </u> T <u>   </u> R <u>   </u> W	<u>   </u>

RECEIVED FOR RECORD  
97 DEC 22 AM 11:29  
PAGE # 605 BKS  
BARBARA HORNSTROM  
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_  
SAME AS CORNER A-4 T34N-R26W

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		10		11		12		13		14		15	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

I, William Lenca, in a field survey on July 23, 1997 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:


NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1847: Original Survey by H. Floyd - B.T.'s - Y. Birch, 18" - N35°W - 22 lks.; Lynn, 16" - S50°W - 24 lks. All original evidence for this corner has been destroyed by county road improvements.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

We found a railroad spike in the centerline of county roads North - South - East, and in line with an old fence to the West. This position has been used by local surveyors for many years, fits well with existing lines of occupation, and is accepted as the best available evidence of the position of the original corner.

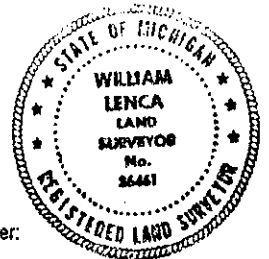

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 5/8" x 24" Iron Rod 3/16" dia. Alum. cap stamped for corner location in Monument Box:

5/8" x 24" Iron Rod/2" dia. Alum. cap marked "WITNESS MARKER" 1.5' S. of P.P.	N35°E	47.61 feet	
5/8" x 24" Iron Rod/2" dia. Alum. cap marked "WITNESS MARKER" 1.0' N. of P.P.	S40°E	38.97 feet	
6" dia. White Ash	S55°W	24.40 feet	Scr. NBT
5/8" x 24" Iron Rod/2" dia. Alum. cap marked "WITNESS MARKER" 1.5' S. of 5" Apple	N49°W	31.24 feet	
Metal Survey Sign Post	N35°E	48.5 feet	

NOTE: All bearings are magnetic bearings. All distances are measured with steel tape. Distances to trees are to nail in side of tree.

Signed by William Lenca  
Surveyor's Michigan License No. 26461

Date Dec. 09, 1997