

SURVEY & REMONUMENTATION

JAN 09 2001

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

Approved by Menominee County
Land Survey Remonumentation
Peer Group Under Act 345 of
P.A. Of 1990 On 7/13, 2000
Mr. Davis RLS
Chairman

For corners in
MENOMINEE
(County)

Located In: _____ Corner Code # _____

1. Public Land Survey T 35N R 26W C-9
 T _____ R _____
 T _____ R _____
 T _____ R _____


2. Property Controlling
in Section S _____ T _____ R _____
 S _____ T _____ R _____

3. Miscellaneous
Property in Sec. S _____ T _____ R _____
 S _____ T _____ R _____

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

Book 6 Page 142

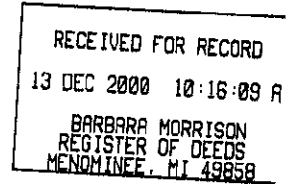

Register of Deeds Stamp & File Number

I, William Lenca, in a field survey on July, 1900 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9			●										
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

- 1848: Original Survey by James H. Mullett - B.T.'s - Hemlock, 12" - S29° W - 18 lks.; Sugar, 15" - N25°E - 16 lks. All original evidence for this corner has been destroyed by County Road improvements.
- 1980: L.C.R.C. No. 261, Book 1, by Gerald W. Carlson, RLS No. 24589 states "Fd. 1-1/4" diam. iron bar, 4" below blktop. Set 5/8" x 24" iron w/RLS cap, 10' north of centerline Co. Rd. "G-12". TIES: Elm 3" - N23°W - 74.60; Power pole - N50°E - 81.39; Power Pole - S64°E - 74.09; W. post of road sign - S02°W - 29.74'.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

We found a 5/8 inch diameter iron rod with plastic identification cap (RLS 24589) 10 feet North of the centerline of an East - West County Road, and in line with the centerline of a county road running North and with an old occupation/field line running South. We also found the Ties described in L.C.R.C. No. 261 (see part A). This corner has been accepted and used by local surveyors for over 20 years, and is accepted as the best available evidence of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner.

Set 5/8" x 24" Iron Rod/3-1/4" dia. Alum. cap stamped for corner location in Monument Box:

5/8" x 24" Iron Rod/2" dia. Alum. cap marked "WITNESS MARKER"	N49°E	80.34 feet	1' W of PP
5/8" x 24" Iron Rod/2" dia. Alum. cap marked "WITNESS MARKER"	S64°E	74.67 feet	1' W of PP
5/8" x 24" Iron Rod/2" dia. Alum. cap marked "WITNESS MARKER"	N45°W	37.97 feet	1' W of Road Sign
5/8" x 24" Iron/yellow plastic identification cap	South	33.00 feet	at Survey Sign Post
Metal Survey Sign Post	South	33.3 feet	

NOTE: All bearings are magnetic bearings. All distances are measured with steel tape. Distances to trees are to nail in side of tree.

Signed by William Lenca
Surveyor's Michigan License No. 26461

Date Aug. 8, 2000



142