

Mac Davis RLS
Chairman

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>MENOMINEE</u> (County)	Located In:	Corner Code #/
1. Public Land Survey	T <u>35N</u> R <u>27W</u>	I-6
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

RECEIVED FOR RECORD
95 NOV - 8 AM 11:31
PAGE # 237 BC 4
BARBARA L. JENNISON
REGISTERED CLERK
MICHIGAN DEPT. OF STATE
RECORDS DIVISION
LANSING, MI 48963

Register of Deeds Stamp & File Number

1. Lot No. _____, Recorded Plat _____
3. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

William Lenca in a field survey on Aug. 03, 1995,
to hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned
in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the
current manual of survey instructions of the United States Department of the Interior, Bureau of Land
Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5
above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a
Court of Law; established, re-established, monumented, re-monumented, recovered, found as
expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded
on this certificate.

3. Description of original monument and accessories and/or subsequent restoration:

- 1848: Original Survey by James H. Mullett - B.T.'s - Cedar, 8" - N67°E - 06 lks; Cedar, 8" - N77°W - 10 lks. All original
evidence for this corner has been destroyed by county road improvements.
- 1985: L.C.R.C. No. 685 recorded by William Lenca, RLS No. 26461, states that a P.K. Nail was set (due to frost depth) in the
centerline of county roads North - South and West, and in line with an ancient fence east. TIES: 9" Tam. - N60°W -
75.97'; 9" Tam. - N74°E - 47.18'; Tel. Cable Box - S45°W - 45.44'.
- 1989: Certified Survey No. 649 recorded by William Lenca, RLS No. 26461, shows corner I-6 as it relates to the 1/16 Corner and
the Section Corner to the South.


3. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

In a May 1995 survey of Section 15, T35N-R27W, we re-established corner I-6, from 2 B.T.'s recorded in LCRC No. 685 (9" dia.
Tamarack - N60°W - 75.97 feet and 9" dia. Tamarack - N74°E - 47.18 feet) We then checked this position with measurements
shown in Certified Survey No. 649, between Corner I-6, the 1/16 Corner to the South and Corner I-7. We found that the alignment
and measurement matched with the record. This corner position has been used consistently for several years by local surveyors, and
is accepted as the best available evidence of the position of the original corner.

Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 2" dia. Aluminum Pipe/3-1/4" dia. Alum cap stamped for corner location:

10" dia. Tamarack - Ex. B.T.	N24°E	47.18 feet	Scr NBT
5" dia. Tamarack	S40°E	46.63 feet	Scr NBT
10" dia. Tamarack	N60°W	75.97 feet	Scr NBT
5" dia. Elm	N20°W	85.58 feet	Scr NBT
Metal Survey Sign Post	East	31.0 feet	

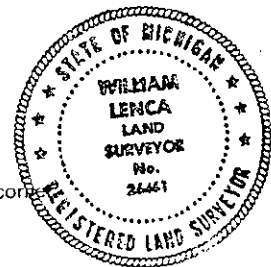

NOTE: All bearings are magnetic bearings. All distances are measured with a steel tape. Distances to trees are to nail in side of
tree.

Signed by William Lenca Date Sept. 6, 1995
Surveyor's Michigan License No. 26461