

FEB 11 1998

Approved by Menominee County
Land Survey Remonumentation
Feet Group Under Act 345 Of
P.A. Of 1990 On 10/31 1997
Mr. Davis RLS
Chairman

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>MENOMINEE</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>38</u> N R <u>27</u> W	<u>L07</u>
	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling in Section	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____

97 NOV 21 PM 3:13
PAGE # 530, BK 5
REGISTERED LAND SURVEYOR
MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS
Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, William Lenca, in a field survey on Sept 11, 19 97 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:


1852: Original Survey by Harvey Mellen - B.T.'s - Cedar, 10" - S27°W - 07 lks.; W. Birch, 12" - N39°E - 15 lks. All original evidence for this corner has been destroyed by logging activities.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

After a careful search of the corner area, we found no evidence of the original corner accessories, or evidence of subsequent restoration. We re-established this corner on line and at a single proportional distance between the Southwest Corner and the Southeast Corner of Section 14, T38N-R27W, and accepted this location as a careful and faithful reestablishment of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
Sct 5/8" x 36" Iron Rod/3-1/4" dia. Alum. cap stamped for corner location:

9" dia. Cedar	N63°E	34.24 feet	Scr. NBT
11" dia. White Spruce	S64°E	4.25 feet	Scr. NBT
9" dia. White Pine	S07°W	34.14 feet	Scr. NBT
14" dia. Cedar	N27°W	16.79 feet	Scr. NBT
Metal Survey Sign Post	North	1.2 feet	

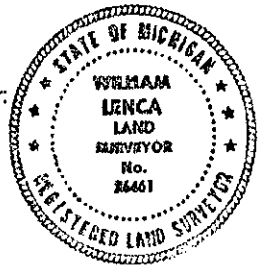

NOTE: All bearings are magnetic bearings. All distances are measured with steel tape. Distances to trees are to nail in side of tree.

Signed by William Lenca
Surveyor's Michigan License No. 26461

Date Sept 11, 1997

530