

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

Maureen P.S.
Chairman

For corners in

MENOMINEE
(County)

Located In: Corner Code #

- | | | |
|------------------------------------|---------------------------|-------------|
| 1. Public Land Survey | T <u>40N</u> R <u>25W</u> | <u>L-12</u> |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| 2. Property Controlling in Section | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |
| 3. Miscellaneous Property in Sec. | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |

RECORDED FOR RECORD
96 OCT -7 PM 3:24
PAGE # 341 BK. 4
SARAH A. MORRISON
REGISTER OF DEEDS
MICHIGAN

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, William Lenca, in a field survey on Aug. 12, 1996 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

A. Description of original monument and accessories and/or subsequent restoration:


1852: Original Survey by Harvey Mellen - B.T.'s - Cedar, 12" - S37°W - 18 lks; Y. Birch, 8" - S23°E - 10 links. All original evidence for this corner has been destroyed by county road improvements.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

This corner was set in accordance with long standing lines of occupation - ancient fence lines running North - South and East. The corner position thus established falls 1.75 feet East of a straight line between the Northeast Corner and the Southeast Corner of Section 34 and 15 feet West of the centerline of a North - South County Road. We accepted this location as the best available evidence of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
Set 5/8" x 24" Iron Rod/3-1/4" dia. Alum. cap stamped for corner location in Monument Box:

7" dia. Cedar	N20°W	4.63 feet	Scr. NBT
12" dia. Cedar	S83°E	31.56 feet	Scr. NBT
8" dia. Maple	S50°E	68.36 feet	Scr. NBT
9" dia. Cedar	South	29.30 feet	Scr. NBT

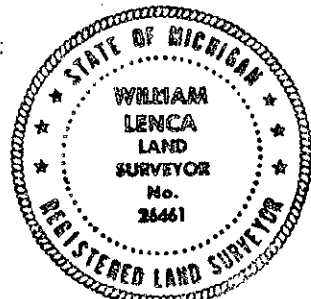

NOTE: All bearings are magnetic bearings. All distances are measured with steel tape. Distances to trees are to nail in side of tree.

Signed by William Lenca
Surveyor's Michigan License No. 26461

Date Aug. 30, 1996

341