


William J. [Signature]  
Chairman

**LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in  
Menominee  
(County)

Located in: Corner Code #

- |                              |             |      |
|------------------------------|-------------|------|
| 1. Public Land Survey        | T 41N R 26W | K7   |
|                              | T 41N R 26W | K6 ✓ |
|                              | T 41N R 26W | L7   |
|                              | T R         |      |
| 2. Property from             | T R         |      |
| in Section                   | T R         |      |
| 3. Miscellaneous             | T R         |      |
| Property in                  | T R         |      |
| 4. Lat No. No. Recorded Plat |             |      |
| 5. Private Claims            |             |      |

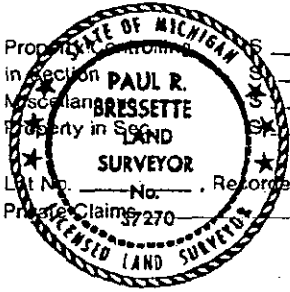

RECEIVED IN RECORDS  
96 JAN -3 11 10:53  
PAGE 320 OK ✓  
BARBARA HORTON  
REGISTERED CLERK  
MENOMINEE COUNTY

Register of Deeds Stamp & File Number

A	B	C	D	E	F	G	H	I	J	K	L	A
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

L7 May 24, 1995  
K6 February 16, 1995

I, Paul R. Bressette, in a field survey on K7 October 20, 1994, 1994, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- (K7) Section corner common to Sections 13, 14, 23 and 24. 1852: E.C. Martin, DS. Set wood post witnessed by: Tamarack 14 S63W 35 links; Spruce 10 N56E 25 links. 1955: Billy D. Buckler, RLS. Set 1" iron pipe with brass cap from original tamarack 8T in excellent condition witnessed by: 8" Cedar N26E 79 links; 8" W. Spruce S45E 28 links. Corner is recorded in Vol.2, p.206 of Menominee County Records.
- (K6) Quarter corner common to Sections 13 and 14. 1852: E.C. Martin, DS. Set wood post witnessed by: Cedar 24 S30E 5 links; Hemlock 12 N35W 20 links.
- (L7) Quarter corner common to Sections 13 and 24. 1852: E. C. Martin, DS. Set wood post witnessed by: Cedar 10 S51W 20 lks.; Cedar 12 N20E 13 lks.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- (K7) Found monument and witnesses as described. Cedar NE is alive and standing, the Spruce SE is a broken off stub. Distance to old NBT is to the center of the tree due to the butt blaze being overgrown. Monument was re-witnessed as found and is accepted as a careful and faithful PERPETUATION of the position of the original corner.
- (K6) No evidence of original survey or restoration found. Search made in October of 1994 revealed several large cedar stumps, but no marks found. No evidence of hemlock found. Corner position re-established mid-point and on-line between the Northwest and Southwest corners of Section 13, and is accepted as a careful and faithful REESTABLISHMENT of the position of the original corner
- (L7) No evidence of original survey found. Found old wood post laying in an old stump, but no corroborating evidence. The wood post was found in a previous DNR survey in 1962 but was not used. Dug for post point at several locations, but found nothing. Corner position re-established mid-point and on-line between the Southeast and Southwest corners of Section 13, and is accepted as a careful and faithful REESTABLISHMENT of the position of the original corner. Corner falls in a small windthrown area.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- |   |  |  |
|---|--|--|
| (K7) 1" iron pipe w/ brass cap<br>11" Cedar N31E 52.4' (old NBT)<br>6" Cedar S08E 12.75' (S24,NBT)<br>5" Cedar S61W 18.55' (S23,NBT)<br>5" Cedar N30W 11.65' (S14,NBT)<br>All NBT's are blazed, scribed, painted and tagged. A metal post with sign was placed next to monument. Distances measured to notch in butt blaze, bearings are magnetic. Distance to old NBT to center of tree. | (K6) 1" iron pipe w/ 4" aluminum cap<br>11" Cedar N37E 26.2' (1/4S,NBT)<br>12" Cedar S62E 20.95' (1/4S,NBT)<br>11" Y. Birch S55W 46.4' (1/4S,NBT)<br>8" Y. Birch N73W 46.5' (1/4S,NBT)<br>All NBT's are blazed, scribed, painted and tagged. Distances are measured to notch in butt blaze, bearings are magnetic. | (L7) 1" iron pipe w/ 4" aluminum cap<br>06" Cedar N72E 11.4' (1/4S,NBT)<br>06" Cedar S15E 13.8' (1/4S,NBT)<br>10" Cedar S83W 25.65' (1/4S,NBT)<br>13" Cedar N59W 21.85' (1/4S,NBT)<br>All NBT's are blazed, scribed, painted and tagged. A metal post with sign was placed next to monument. Distances are measured to notch in butt blaze, bearings are magnetic. |
|---|--|--|

Signed by Paul R. Bressette Date 1-3-95

Surveyor's Michigan License No. 37270