

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. PA 1970

For Corners In: Missaukee Located In _____ Corner Code # _____
(County)

1. Public Land Survey T 21N R 6W L11
T _____ R _____ L _____

2. Property Controlling in Section S _____ T _____ R _____
S _____ T _____ R _____


3. Miscellaneous Property in Section S _____ T _____ R _____
S _____ T _____ R _____

4. Lot No: _____ Recorded Plat: _____

5. Private Claims: _____

I, Craig W. McVean, in a field survey on Nov. 2, 2004 do hereby state that under requirements of PA 74, Michigan PA of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

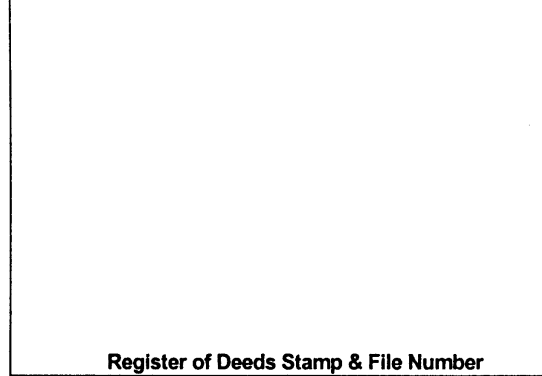

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11											●		
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

L11 - GLO - W. L. Coffinberry - 1852
 Set 1/4 Post
 Black Pine 11" diam. N30¼°W 15½ L.
 White Pine 5" diam. S37½°E 14 L.
 - LCRC #887 - C. F. Roser - 1992 -
 Re-established South 1/4 corner of Section 25 midway and on-line between Southeast and Southwest Sec. Cor's. Easterly edge of Marsh is 40' (15'±) West and 140' (20'±) North. Corner falls in 2 acre ± clear cut. Old fence post and newer Yellow top steel posts across marsh bearing N'ly are 24' (±2') North. No evidence of fence corner. Set DNR monument and Cedar post.
 11" White Birch N20°W 93.56'
 10" Twin Oak S15°W 158.55'
 13" Oak S15°E 192.38'

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

L11 - ¼ common to Sections 25 & 36, T21N, R6W - Found DNR Monument, 4" Aluminum Cap on 1" galvanized pipe with Cedar post 1.5' SSW. All Roser BT's gone. DNR Mon. accepted as a careful and faithful re-establishment of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

L11 - 4" Aluminum DNR Monument on 1" galvanized pipe
 S73°E 20.35' to set N & T in South side 5" Jack Pine
 N18°E 13.64' to set N & T in West side 4" Cherry
 N66°W 20.32' to set N & T in South side 3" Twin Cherry
 S11°E 32.26' to set N & T in West side 5" Jack Pine
 Cedar post 1.5' SW



Signed by: Craig W. McVean
 Surveyor's Michigan License No.: 39088

Date: 3/7/2005