1893

	and the second	LAND CORN	ER RECORDATION CERT	rificate Jan 21 PM 3 27	
For corners in		Filing Requir	Filing Requirement of Act 74, Mich. P.A. 1970		
_	Newaygo	_ Located In:	Corner Code ##	Marlone Toogood	
1.	(County) Public Land Survey	1 14N R 12W	A-1	VOL 001 PAGE 41	
		T R T R T R			
2.	Property Controlling in Section	S T R S T R		;	
3.	Miscellaneous Property in Sec.	S T R S T R		Register of Deeds Stamp & File Number	
		corded Plat		ABCDEFGHIJKL	
5.	Private Claims			2 6 5 4 3 2	
	Norman L. Ochs	Sin a field survey onDe	cember 493	4	
l, . do	hereby certify that under requ	in a field survey on airements of P.A. 74, Michigan P.A	of 1970, the corner points men	tioned 6	

in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:


NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

NW Corner, Section 6, Wilcox Twp.

Description of original monument and accessories and/or subsequent restoration: 5.L.O. John Hodgson 1973 New. Eng. & Sur. Co. 2" Pine S45°W 57 Lks #1 Fnd. 3/4" Pipe G.L.O. John Hodgson 12" Pine S45°W 57 Lks #1 18" Oak N50°W 28.04' #. 15" Oak S05°E 26.07' #6 24" Oak N70°E 53.01' #7 13" Pine N5°E 26 Lks #3 #5

No. 1, Pg.15 Lyle Shepherd's Wit. Book/ 24" Pine Stp S8°30'E 34+ #3

30" Pine Stp N28°E 33'±#4

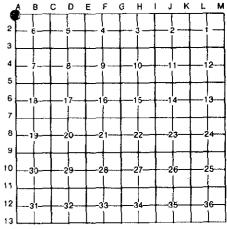

1973 Clint Cole RLS#17615 Fnd. same 3/4" Pipe & wit. as N.E.&S. See survey recorded in Series G-9131

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner: In 1993 New. Eng. & Sur. Co. found a 3/4" pipe, honored for Section corner, removed the 3/4" pipe and replaced with 4" cast iron Harrison monument.

Condition of recorded witnesses is: #1, gone, #3 gone, #3 gone, #4 gone, #5 good condition, #6 good condition, #7, good condition.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner. Accepted 4" Harrison cast iron monument as a substantial marker for the section corner and is accepted as a careful and faithful re-establishment of the position of the original corner. of MICHIC

16" B. Oak S0°E 25.99' Nail in East side of tree #6. 20" B. Oak N49°W 27.73' Nail in SW side of tree #5. 11" W. Oak N9°W 23.36' Nail in East side of tree

26" B. Oak N69°30' E 53.30' Nail in SW side of tree #7.

orman Ochs Signed by Norman L.

Date December 15, 1993

Surveyor's Michigan License No. Approved by Peer Review Group Dec. 21, 1993

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971 REVISED MAY 14, 1975 REVISED JAN., 1983

NORMAN L. OCHS

LAND SURVEYOR

Norman L. Ochs, County Representative