

LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970

94 JAN 21 PM 3 28
Marlene Toogood

For corners in

NEWAYGO
 (County)

Located In:

Corner Code #:

1. Public Land Survey T 15N R 12W A-1
 T ___ R ___
 T ___ R ___
 T ___ R ___
 2. Property Controlling S ___ T ___ R ___
 in Section S ___ T ___ R ___
 3. Miscellaneous S ___ T ___ R ___
 Property in Sec. S ___ T ___ R ___
 4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

VOL 001 PAGE 51

Register of Deeds Stamp & File Number

I, Norman L. Ochs, in a field survey on November 1, 1993, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

N. W. Corner, Sec. 6, Monroe Township

A. Description of original monument and accessories and/or subsequent restoration:

G.L.O. John Hogdson 1838 8/26/68 R. A. Griffin
 16" W Oak S65°E 16 lks. #1 5" sq. conc. monument
 12" W Oak N76°W 4 lks #2 7" R. Pine N57°E 53.16' #3
 Lilley Undated N.C.R.C. Sheet 5" R. Oak S58°W 80.85' #5
 8" Pine S50°E 37.6' 7" R. Pine S47°E 41.94' #4
 10" Pine S32°W 15.5' 4" Sq x 7' Pine Post W 2.3' #6

4/25/84
 New. Eng. & Survey Co.
 5" sq. conc. monument
 7" R Pine N57°E 53.16' #7
 7" R Pine S47°E 41.94' #8
 5" R. Oak S58°W 80.85' #9
 4" Sq x 7' Pine Post W
 2.3' #10
 8" W Oak N88°W 69.23' #11

1900 Survey of Sec. 31 Book A, Pg 293
 T16N, R12W D. Anderson, County Surveyor
 20" Pine North 16 lks

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


R. A. Griffin in/1968 set ^{found iron pipe} 5" sq. conc. monument. L.C.R.C. #168.
 Found Griffins conc. monument in good condition.

Condition of witnesses is: #1 gone, #2 gone, #3 good condition, #4 good condition, #5 good condition, #6 gone, #7 good condition, #8 good condition, #9 good condition, #10 gone, #11 good condition.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Accepted Griffins 5" sq. conc. monument as a substantial marker for Section corner and is accepted as a careful and faithful reestablishment of the position of the original corner.

12" R Pine N57°E 53.12' (Spike in SE side of tree) #3, #7.
 7" R. Pine S47°E 41.95' (Spike in South side of tree) #4, #8.
 5" R. Oak S58°W 80.91' (Spike in North side of tree) #5, #9.
 8" W. Oak West 69.26' (Spike in South side of tree) #11.
 CL of North & South road West 22'.

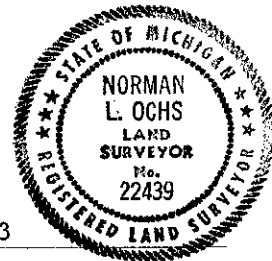

Signed by Norman L. Ochs
 Norman L. Ochs 22439

Date November 8, 1993

Surveyor's Michigan License No. _____
 Approved by Peer Review Group Nov. 9, 1993
 Norman L. Ochs, County Representative

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
 REVISED MAY 14, 1975
 REVISED JAN., 1983

SURVEY &
 REMONUMENTATION

DEC 07 2000

SECTION