

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

'94 JAN 21 PM 3 28

Marlene Toogood

VOL 001 PAGE 50

Register of Deeds Stamp & File Number

For corners in

NEWAYGO

(County)

Located In:

Corner Code ##

- 1. Public Land Survey T 15N R 13W B-3
2. Property Controlling in Section S T R
3. Miscellaneous Property in Sec. S T R
4. Lot No. Recorded Plat
5. Private Claims

Grid table with columns A-M and rows 2-12. A dot is marked at row 3, column C.

I, Norman L. Ochs, in a field survey on November 6, 1993 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

S-1/4 Corner, Sec. 6, Merrill Twp., Newaygo County, MI13

A. Description of original monument and accessories and/or subsequent restoration:

- G.L.O. Resurvey, Milton Nye 1856 10-11-66 R. A. Griffin 1923 Survey by N.C.R.C. Iron Pine Root & Glass
8" W. Pine N47°W 37 lks #1 RLS #13584 12" B Oak N34°E 53.6' #3
7" W. Pine S23°E 11 lks #2 5" sq. conc. mon. 12" B.Oak S36°W 61.0' #4
8" B. Oak S22°E 122.15' #8
23" B. Oak S36°W 60.80' #9
Undated N.C.R.C. Notes 6'x6" Tw. W. Oak N34°W 97.26' #10
10" B. Oak N3°E 51.62' #5 4' sq. x 7' Pine Post N 33' #11
18" B. Oak S36°W 60.3' #6
14" Twin Maple S62°W 88.6' #7


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

October 11, 1966, Robert A. Griffin and John D. Avery found 3/4" sq. x 20" iron rod in the centerline of the E & W blacktop road. He replaced the 3/4" sq. iron with a 5" sq. reinforced conc. post 3 feet in length set 1 foot below the surface. A round 3" dia. brass disk is cast flush w/the top of the monument. #LCRC #119 Nov. 6, 1993 N. L. Ochs Found conc. monument with 1/2" rod riser in good condition and accepted as found. Condition of recorded witnesses is: #1 gone, #2 gone, #3 gone, #4 good, #5 gone, #6 good, #7 gone, #8 good, #9 good, #10 gone, #11 gone.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Accepted R. A. Griffin's conc. monument w/1/2" rod riser as a substantial marker for the 1/4 corner, and is accepted as a careful and faithful re-establishment of the position of the original corner.

- 10" B. Oak S24°E 122.25' (Spike in East side of tree) #3
25" B. Oak S38°W 60.75' (Spike in East side of tree) # 4 & #6
8"-8" Tw. Oak N42°W 81.39' (Spike in West side of tree)
10" B. Oak N05°E 81.02' (Spike in West isde of tree)

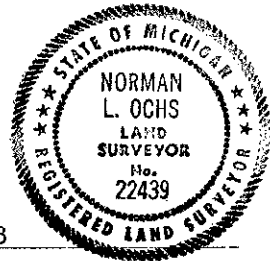

Signed by Norman L. Ochs Surveyor's Michigan License No. 22439

Date November 8, 1993

Approved by Peer Review Group Nov. 9, 1993 Norman L. Ochs, County Representative

SURVEY & REMONUMENTATION

JEG 07 2000

SECTION