

SURVEY & REMONUMENTATION

APR 24 1995

1994 NEWAYGO COUNTY REMONUMENTATION PROJECT

COMMISSION

LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970

VOL 001 PAGE 137
 NEWAYGO COUNTY
 REGISTER OF DEEDS
 MARLENE TOOGOOD


For corners in

Newaygo (County)	Located In:		Corner Code #
	15N	13W	
1. Public Land Survey	T _____ R _____	C-5	_____
	T _____ R _____		_____
	T _____ R _____		_____
	T _____ R _____		_____
2. Property Controlling in Section	S _____ T _____ R _____		_____
	S _____ T _____ R _____		_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____		_____
	S _____ T _____ R _____		_____

'95 MAR 14 PM 3 58
Marlene Toogood

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

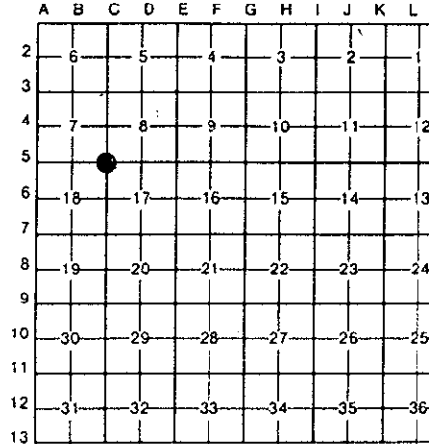

I, Norman L. Ochs, in a field survey on December 1, 1994, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

S.W. Corner, Section 8, Merrill Twp., Newaygo Co., MI

A. Description of original monument and accessories and/or subsequent restoration:

C-5 - Southwest corner Section 8, T15N, R13W, Merrill Township, Newaygo County, Michigan.

- G.L.O. Milton Nye - 1856
- 12" Maple N41°E 11 Links (7.26') #1
- 8" Beech S20°W 38 Links (25.08') #2

Delos A. Anderson, County Surveyor, May 9-14, 1900

- Book "A", Pages 297 and 298
- 30" Pine S30°W 20 Links (13.2') #3
- 12" Pine West 8 Links (5.28') #4
- Measured 40 chains (2640') from the Southeast corner to the South 1/4 corner Section 7. Measured 80 Chains (5280') from the Southwest corner to the Southeast corner Section 8.

(SEE OVER FOR CONTINUATION OF "A")

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

C-5 - Southwest corner Section 8, T15N, R13W, Merrill Township, Newaygo County, Michigan.

I found 5" x 60" U.S.F.S. Concrete Monument 15 feet West of the centerline of North and South dirt road. Monument projects 1 foot above ground level. Condition of the accessories are as follows: #1 Gone, #2 Gone, #3 Found remains of stump, #4 Found stump #5 Found in good condition, #6 Found in good condition, #7 Gone, #8 Found in good condition, #9 Found in good condition, #10 Found in good condition, #11 Found in good condition, #12 Found in good condition.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


C-5 - Southwest corner Section 8, T15N, R13W, Merrill Township, Newaygo County, Michigan.

I accepted the 5" x 60" U.S.F.S. Concrete Monument as a substantial marker for the corner, and is accepted as a careful and faithful re-establishment of the position of the original corner.

- 7" Maple N39°E 108.46' (dock spike in N.W. side) O.B.T. #8
- 9" R. Oak N51°W 128.19' (dock spike in S.W. side) O.B.T. #11
- 12" R. Oak S75°E 100.90' (dock spike in N. side) O.B.T. #9
- 18" B. Oak S50°W 48.50' (60d spike in S.E. side) O.B.T. #6
- 21" W. Oak N83°E 45.60' (60d spike in S. side) O.B.T. #5

Signed by Norman L. Ochs
 Norman L. Ochs 24436
 Surveyor's Michigan License No. _____

Date December 13, 1994

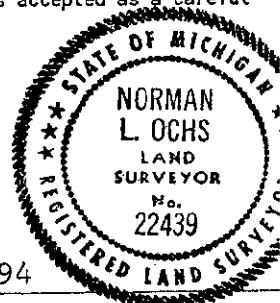

Approved by Peer Review Group on December 15
 Norman L. Ochs, County Representative. *N.L.O.*

CONTINUATION OF "A" - DESCRIPTION OF ORIGINAL MONUMENT AND ACCESSORIES AND/OR SUBSEQUENT RESTORATION:

George H. Johnson - 1925

Iron - L.C.R.C. #125 -

10" W. Oak N79°E 45.5' #5

8" B. Oak S45°W 48.2' #6

Robert A. Griffin, R.L.S. #13584 - October 27, 1966 L.C.R.C. #125

Found 1" iron pipe at the intersection of old fence North and West on the West side of the North and South earth road.
Replaced with 5" Square reinforced concrete post with brass disk.

4" x 7' Pine Post West 1.1' #7

5" Maple N35°E 108.58' #8

17" W. Oak N79°E 45.60' (O.B.T.) #5

6" R. Oak S75°E 100.97' #9

15" B. Oak S45°W 48.50' #10

5" R. Oak N52°W 128.23' #11

Robert L. Wetherell, R.L.S. #24624 - September 1, 1989 - Recorded in Liber 349, Page 2366.

7" Maple N35°E 108.58' #8

12" R. Oak S75°E 100.97' #9

20" B. Oak S45°W 48.50' #10

20" W. Oak S79°E 45.60' #5

Measured 2635.13 feet from the Southwest corner to the West 1/4 corner Section 8. Measured 2645 feet from the Southeast corner to the South 1/4 corner Section 7.